

Work Order ID 126548

126548

Page 1

Friday, January 30, 2015 2:26:59 PM

Item ID: D407-667-205 USED

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Aft Crosstube - High 407

Start Date: 11/13/2014 Start Qty: 1.00

1

Cust Item ID:

Required Date: 11/14/2014 Req'd Qty: 1.00

1

Customer: CRLCL01

Reference: RMA RA111880

Approvals: Process Plan: mf

Date: 15-1-30

Tooling:

Date:

Run Start *NR1*

QC:

Date:

SPC (Y/N):

Date:

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D407-667-245

Rev F/DEO

0.00

100

100

QC

Quality Control

Memo

0.00

INSPECT RA 111880 D407-667-205 X 1 B85315

TUBE HAS FLOWN AND CAN ONLY BE SOLD AS A USED PART

TUBE HAS CORROSION ON CENTER SECTION

PERFORM REWORK AS PER RS1028

RS 1027

0.00

110

110

Crosstubes

Crosstubes

Memo

0.00

SEE RS1027

① 1504.16 PD

PTO →

DAS
46

APR 13 2015

FL97

DQA:

Date:

15/05/08

DART
AEROSPACE

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed:

Date:

15/04/30

Work Order update only ☐

Work Order: 126548

Part No. D407-667-2050560

NCR No. 15-4832

DISPOSITION

Rework ☒Scrap ☐Use-as-is ☐Suspected Unapproved ☐

AGAINST DEPARTMENT/PROCESS

Skid-tube ☐Machining ☐Thermoforming ☐Large Fab ☐Crosstube ☒Small Fab ☐Finishing ☐Composite ☐Water Jet ☐Prod. Eng. Coord. ☐Rec/Store/Packaging ☐Supplier ☐Engineering ☐Quality ☐Other ☐

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design				All Nut Plates. w/ Rework	DAS	RE install before Prim.			PD
Doc/Data				D2873-043 / D2873-045	16	w/ Rework			150416
Equip/Tooling					9-89	Rework			
Handling/Pre				And keep w/ Tube to be					
Material				Reinstall.	Q2042	MS 20601AD4W8			
Operator				Reinstall.	15/03/08	AN			
Offset/Setup				Reinstall.					
Process				Reinstall.					
Supplier				Reinstall.					
Training				Reinstall.					
Transport				Reinstall.					
Unapproved				Reinstall.					

FAULT CATEGORY

Landing Gear

- ☐ Bending
☐ Centre Not Concentric
☐ Cracks
☐ Crimp/Kink/Ripple/Wave
☐ Cuffs
☐ Crushing
☐ Heat Treat
☐ Inspection Strip in Tube
☐ Marks/Chatter
☐ Turning Sequence
☐ Wave/Twist in Tube

General

- ☐ Bend
☐ BOM/Route
☐ Broken/Damage/Defect
☐ Burrs
☐ Contamination
☐ Countersink
☐ Cut Too Short
☐ Drawing
☐ Drill Holes
☐ Finish
☐ Fit/Function

- ☐ Folio/Program
☐ Grain
☐ Hardware
☐ Inspection Incomplete/Unqualified
☐ Instructions Incomplete/Unclear
☐ Misaligned/off center
☐ Mislabeled
☐ Misread
☐ Off-set
☐ Out of Calibration
☐ Out of Sequence

- ☐ Outside Dimensions
☐ Over/Under tolerance
☐ Part Incorrect
☐ Part Lost/Missing
☐ Part Moved
☐ Positioned Wrong
☐ Power Loss/Surge
☐ Pressure/Forced
☐ Set-up
☐ Temperature/Cure
☐ Weld
☐ Wrong Stock Pulled
☒ Other

Rework

Work Order ID 126548

Friday, January 30, 2015 2:26:59 PM

126548

Page 2

Item ID: D407-667-205 USED

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Aft Crosstube - High 407

Start Date: 11/13/2014 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 11/14/2014 Req'd Qty: 1.00 ***1***

Customer: CRLCL01

Reference: RMA RA111880

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	QC21- Final Inspection - Work Order Release	0.00							
120									
QC	Memo	0.00							
Quality Control									

MW 1504-27

MW 1504-27

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence
		☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge
		☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other

Picklist Print

Friday, January 30, 2015 2:26:34 PM

Page 1

Work Order ID: 126548

126548

Parent Item: D407-667-205 USED

D407-667-205 USED

Parent Item Name: Aft Crosstube - High 407

Start Date: 11/13/2014

Required Date: 11/14/2014

Start Qty: 1.00

Required Qty: 1.00

Comments:

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

AN5-10A

Purchased

No

Each

91.0000

10

AN5-10A

BOLT

D/S

4.5

9-9

Location

Loc Qty

Loc Code

GA

51

122800

51

ST338

40

M131305

40

M131624

DAS
27
9-9
APR 10 2015

68-6
9-9
DAS
4.5
9-9

AN5-32A

Purchased

No

Each

395.0000

4

AN5-32A

Bolt

L/S

4.5

9-9

Location

Loc Qty

Loc Code

ST299A

371

m128403

71

m130716

200

m131139

100

ST336

24

m128634

24

DAS
27
9-9
APR 10 2015

DAS
4.5
9-9
DAS
4.5
9-9

AN5-34A

Purchased

No

Each

79.0000

4

AN5-34A

Bolt

D/S

4.5

9-9

Location

Loc Qty

Loc Code

ST336

79

m128634

79

DAS
27
9-9
APR 10 2015

DAS
4.5
9-9
DAS
4.5
9-9

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Picklist Print

Page 2

Friday, January 30, 2015 2:26:48 PM

Work Order ID: 126548

126548

Parent Item: D407-667-205 USED

D407-667-205 USED

Parent Item Name: Aft Crosstube - High 407

Start Date: 11/13/2014

Required Date: 11/14/2014

Start Qty: 1.00

Required Qty: 1.00

D3190-1

Manufactured No

Each

5.0000

2

D3190-1

Chaffing Shield

W/A
DAS 27
APR 10 2015

Location

Loc Qty

Loc Code

LG053

5

126583

5

Each

54.0000

2

D3595-063-450

Manufactured No

D3595-063-450

Rubber Cushion

Location

Loc Qty

Loc Code

FG

6

88422

6

LG051

48

115780

48

Each

0.0000

1

D407-667-205 USED

Manufactured No

D407-667-205 USED

Aft Crosstube - High 407

1x 85315 MF 15-1-20

MS21042L5

Purchased No

MS21042L5

Nut

Each

939.0000

4

✓

DAS 27

APR 10 2015

Location

Loc Qty

Loc Code

GA

496

m127813

496

ST305

443

m131340

443

4

DAS 27
9-17

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Picklist Print

Friday, January 30, 2015 2:26:53 PM

Work Order ID: 126548

126548

Parent Item: D407-667-205 USED

D407-667-205 USED

Parent Item Name: Aft Crosstube - High 407

Start Date: 11/13/2014

Required Date: 11/14/2014

Start Qty: 1.00

Required Qty: 1.00

MS21920-22 Purchased No

Each 171.0000 4

MS21920-22

Clamp

WJA DAS 27

Location

Loc Qty

Loc Code

LG050

171

M128636

96

M130822

75

MS21920-25 Purchased No

Each 63.0000 2

MS21920-25

Clamp

Location

Loc Qty

Loc Code

FG

10

120920

10

LG050

53

M130400

13

M131367

40

NAS1149D0563J Purchased No

Each 1,777.000 18

NAS1149D0563.J

Washer

Location

Loc Qty

Loc Code

GA

130

m125807

130

ST260a

400

m130799

400

ST269

247

16527

4

m128257

243

ST271

1000

m131026

1000

DAS 27 9-89 9-89
APR 10 2015

18

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---

DART AEROSPACE LTD	Work Order: 83315
Description: Corrosion in center of Crosstube	126548
Drawing: D407-667-245	Repair Scheme: RS1027
Part No: D407-667-203 Aft Crosstube	Page: 1 of 2
Batch No: B85315	Qty: 1

Step	Location	Procedure	By	Date	Qty
1	Quality Assurance	Inspect Condition of RA 111880 D407-667-205 B85315 CHG008 - Removed from A/C N595RL - Original removal tag attached to work order - No hardware returned with kit Check the following POOR / USED ☐ DAMAGED / USED ☐ CORRODED / USED ☒ NEW ☐			
2	Finishing / Crosstube assembly	Remove the following hardware from tube - D2894-1 Support B75212 clean off all Scotch-Weld & clean support entirely and tag to be reinstalled on the cross tube - Discard all MS21920-25 Clamps & D3596-063-430 rubber cushions - MS21920-22 clamps qty x4 and discard - Remove D3190-1 Chafing Strips x2 locations & Discard - Remove nut plate and discard	CR	2015-02-24	1
3	Finishing / Crosstube assembly	Strip center section as instructed by QA Coordinator as per QSI 005 (All paint & Primer to be removed)	CR	2015-02-29	1
4	QC 15 Quality Control	Measure all dimensions as per DWG / ICA (Attached) & fill out on the crosstube dimension sheet	03-189	15-2-24	1
5	Landing Gear / Crosstube	Buff out all corrosion to acceptable ICA limits	BC	15-03-20	1
6	Landing Gear / Crosstube	Preform ultrasonic measurements in the locations from the original work order D407-667-205TRN B84103 Fill out wall thickness measurement on FAI	DAS 28-989	15/03/10	1
7	QC 5 Quality Control	Inspect work to current step	03-189	15/03/10	1
8	Outsource / Purchasing	Preform LPI / Eddy Current as per QSI 038 PO# 27806	CL	15/03/17	①
9	QC 6 Quality Control	Review results and ensure they are attached	03-189	15-03-17	1
10	Finishing	Wash tube in alcohol Acid etch tube as per QSI 005 → primed inside; scuff with scotchbrite Alodine the tube as per QSI 005	DAS 41-9-89	15/3/18	1
11	QC 7 Quality Control	Inspect alodine finish as per QSI 005 & QSI 012	CR	15/03/14	①
12	Finishing / Crosstube Assembly	Touch up areas with primer and prime as Per QSI 005 Tempo 4500-PB-23Y-BG B# Exp. Date # / / Clear coat B# 130762	DAS 44-9-89 A8	15-3-23 15-3-23	1

D2894-1
was damage
and could
not be
re install
scrap
PD
15-02-24

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="width:25%;">Skid-tube ☐</td> <td style="width:25%;">Crosstube ☐</td> <td style="width:25%;">Water Jet ☐</td> <td style="width:25%;">Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

DART AEROSPACE LTD	Work Order:	
Description: Corrosion in center of Crosstube		
Drawing: D407-667-245	Repair Scheme:	RS1027
Part No: D407-667-203 Aft Crosstube	Page:	2 of 2
Batch No: B85315	Qty:	1

13	Finishing / Crosstube Assembly	Mask Customer installed Wing Walk Re paint entire tube as per QSI 005 White DuPont Imron Polyurethane Enamel Base White 3.5HG (33-24861) B# <u>131599</u> Exp. Date # <u> </u> / <u> </u> / <u> </u> N/A	DAS 41 9-89	15-3-23	1
14	QC 14 Quality Control	Inspect finish of tube	DAS 38 9-89	15-03-27	1
15	Finishing / Crosstube assembly	Assemble as per DWG Install Chafing Shield as per DEO D407-667-245. Ensure that the overlapping edge of the chafing shield is located at approximately 60° from bottom vertical to prevent deterioration of the rubber bumpers. Be sure to eliminate any air gaps. D3190-1 x2 B# <u>126583</u> MS21920-22 x4 M# <u>130822</u> A/R Proseal 890 B# <u>131670</u> Exp.: <u>—</u> / <u>10</u> / <u>15</u> Lightly Scuff the bonded are using 320 grit sand paper and clean area with 41058 wash'n'wipe Install new D3594-1 B# <u>1305251</u> Install original D2894-4 using Scotch-Weld DP460 and install clamps as per DEO D407-667-245 using installation jig DT9025. Torque clamps according to Dwg A/R Scotch-Weld DP460 B# <u>130684</u> Exp.: <u>—</u> / <u>10</u> / <u>15</u> MS21920-25 x2 M# <u>131651</u> D3595-063-430 x2 B# <u>129907</u> <u>127801</u> Install nut plate <u>2X 2873-043 2X 2873043</u> D3595-063-430 D3595-063-430 125280 5-12-26	DAS 41 9-89	15-3-26	1
16	QC 5 Quality Control	Inspect locations for Installed hardware as per Dwg Inspect Torque of clamps to 80-100 IN-LB	DAS 38 9-89	15-03-27	1
17	Stores / Packaging	Pick kit AN5-10A M# <u>M131624</u> x10 AN5-34A M# <u>M131624</u> x4 AN5-32A M# <u>M130716</u> x4 MS21042L5 M# <u>M127813</u> x4 NAS1149C0563J M# <u>M131026</u> x18 New label with identification as USED part	DAS 27 9-89	APR 27 2015	1
18	QC 4 Quality Control	Inspect Kit for completeness and ensure labels are correct	mm	APR 28 2015	
19	Packaging	Identify & Stock as USED	mm	APR 28 2015	
20	Quality Control	QC21	MCS	15-04-27	1

Rev	Date	Change Description	Prepared	Checked	Approved
A	14.11.12	New Issue	ED		

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

RA 111880 D407-667-205

B85315

Received @ Dart November 6th, 2014
Inspected@ Dart November 12th, 2014

CUSTOMER: RLC LCC
CUSTOMER CONTACT: JOHN GILLEY
SHIPPED FROM: BROUSSARD, LA USA

Instructions for RA 111880 D407-667-205 B85315 CHG008

- TUBE HAS FLOWN AND CAN ONLY BE SOLD AS A USED PART
- Tube has corrosion on center section
- Preform rework as per RS1028

Time Estimate = 18 HOURS

Departments Required: Crosstube assy, Quality, Outsourcing & Stores

Pictures Attached = YES

Still at current CHG008

QTY INSPECTED = x1 D407-667-205 B85315

**THIS INSTRUCTION SHEET MUST
BE ATTACHED TO THE
RESTOCKING WORK ORDER AT
ALL TIMES!!!!**

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____



Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

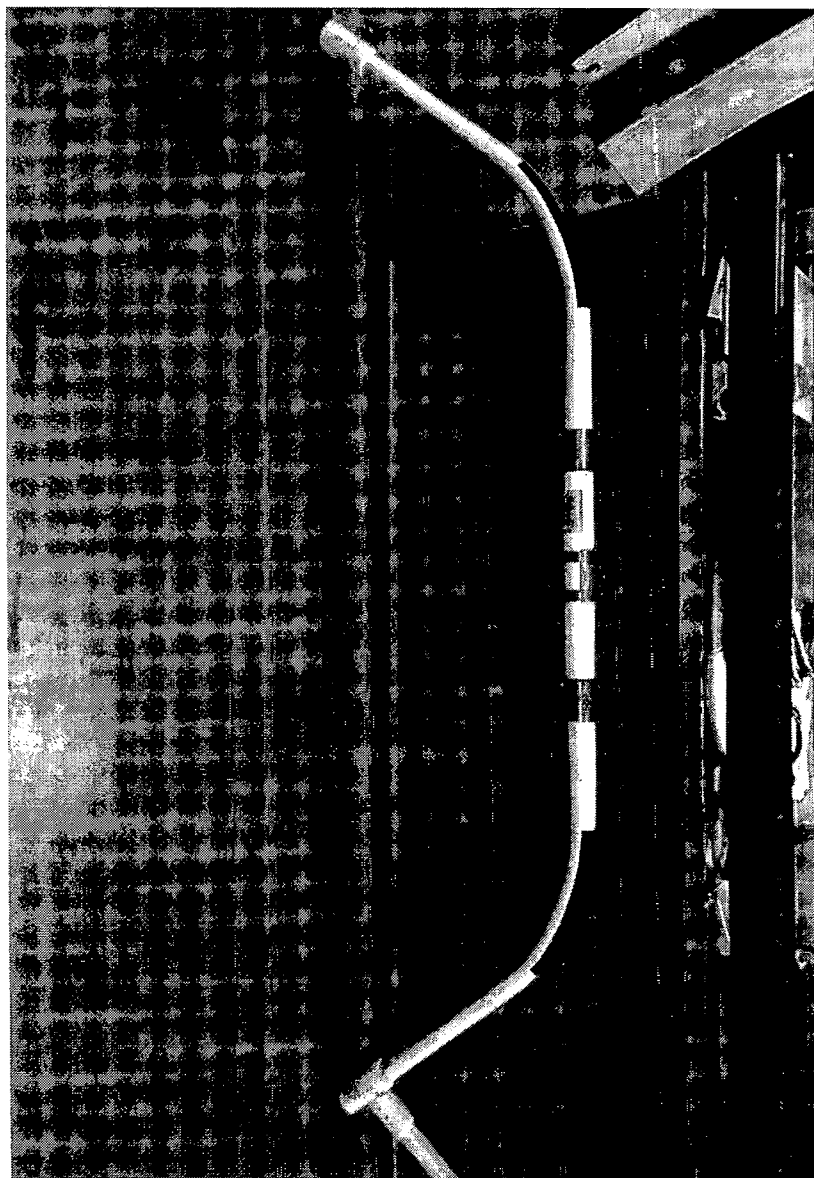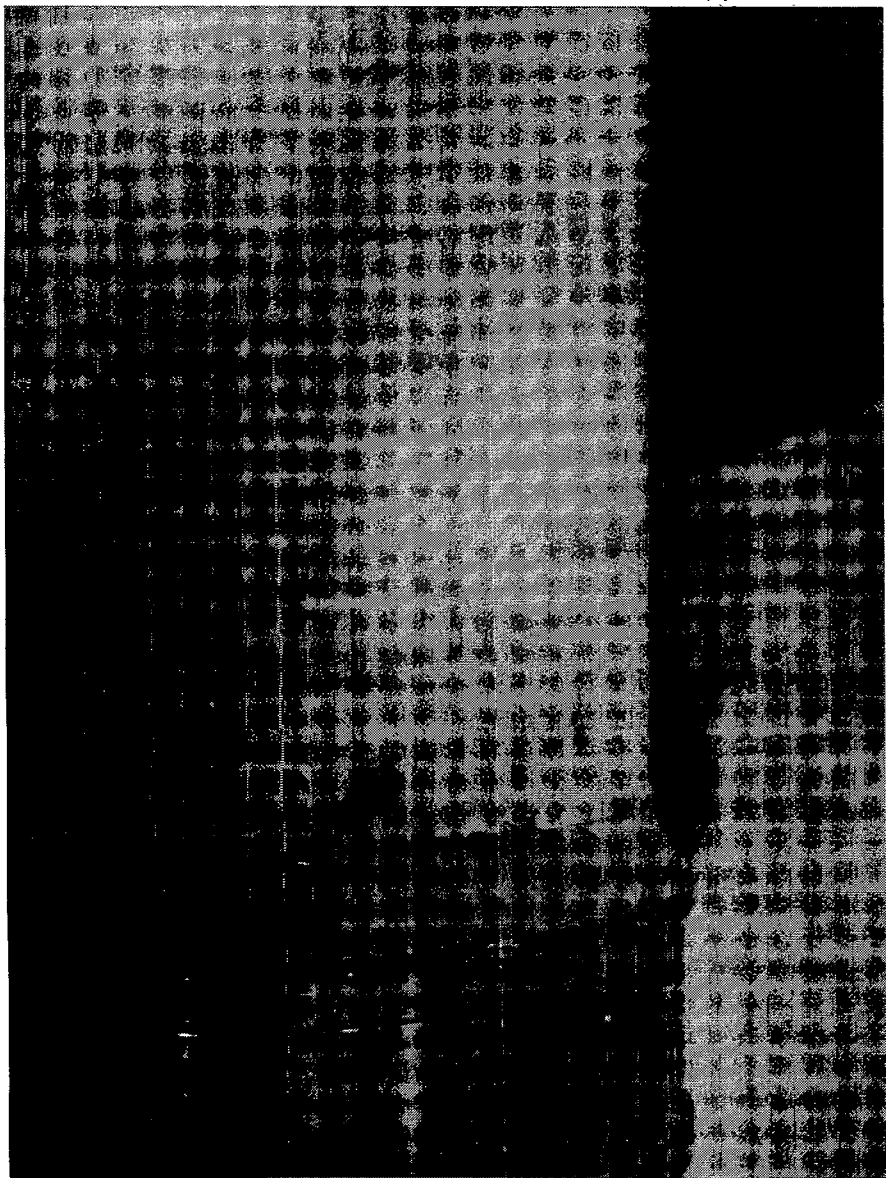

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____



Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

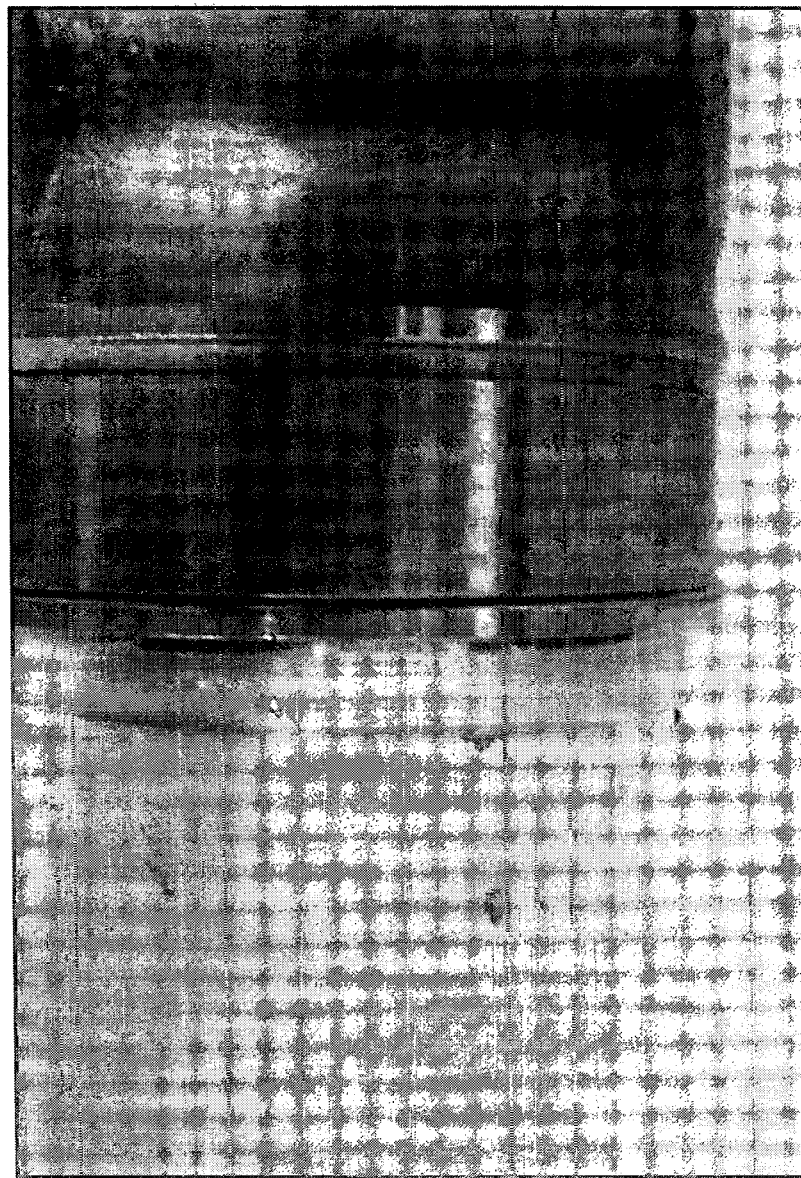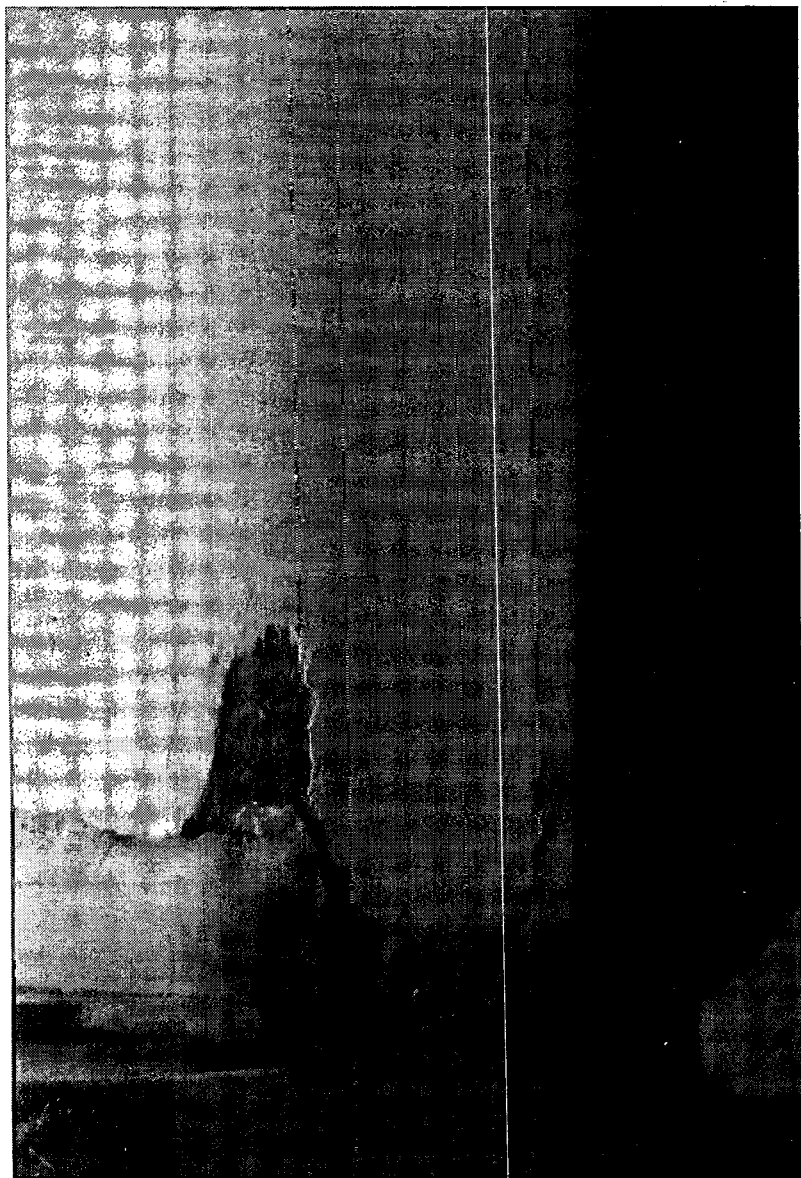

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

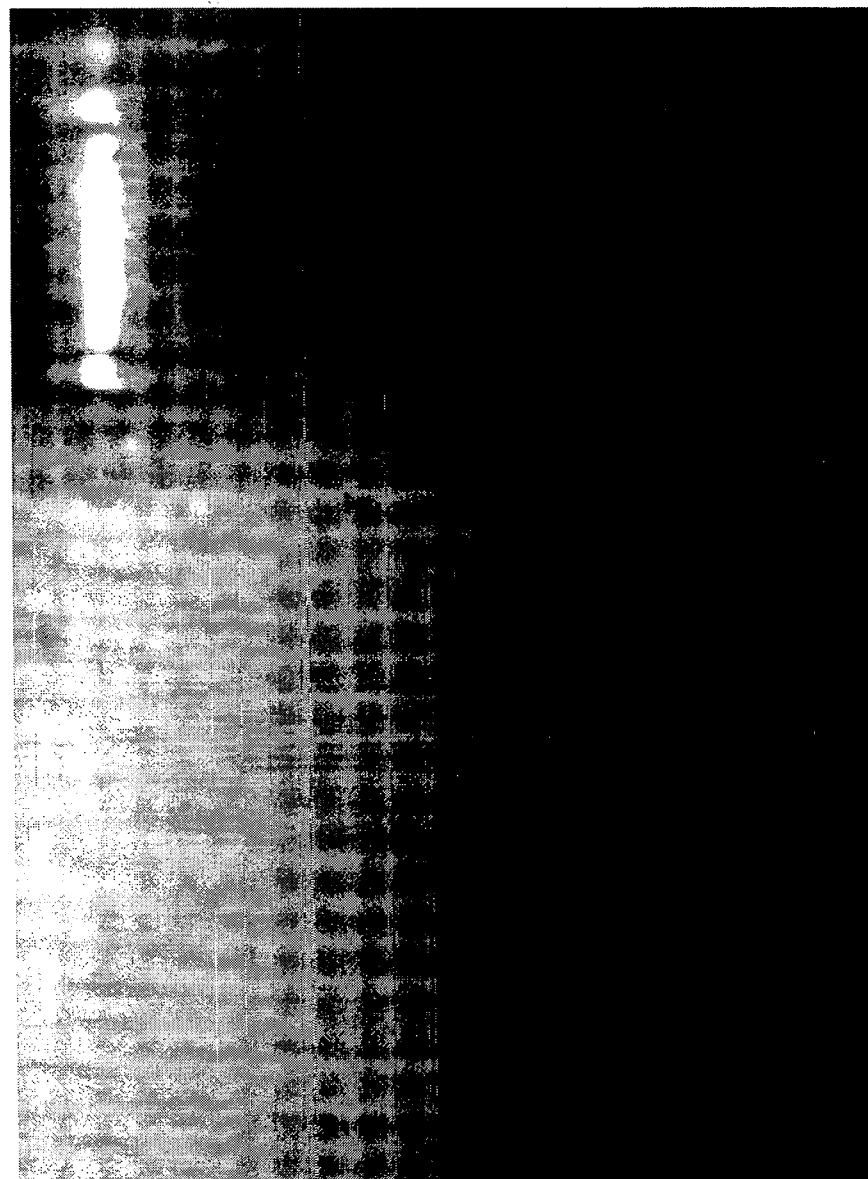

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																


Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

DART AEROSPACE LTD		Work Order:	
Description: Crosstube High Aft (407)		Part Number:	D407-667-205
Inspection Dwg: D407-667-245 Rev: F			Page 1 of 1

Required Dimension	Min	Max
Height	23.39	23.65
1/2 Span	45.79	46.05
Angle	54	56
Total Span	91.58	92.100
Bending Passes	6	--
Crushing	--	6%

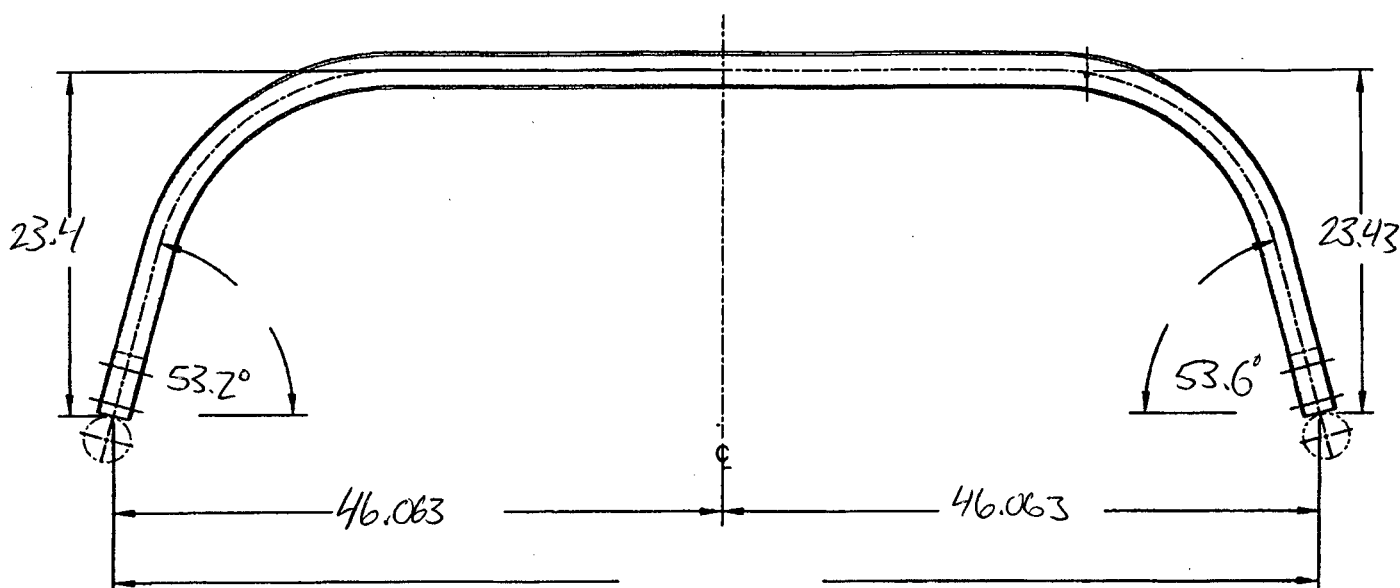

	Side A	Side B
Bending Passes		
Crushing		
Comments		

QC15 Inspection	<i>DP</i>
Date	15-2-24

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	09.06.22	Dwg Rev updated	KJ	
C	11.08.22	Dimensions updated	KJ	
D	11.09.30	Dimensions updated	KJ	
E	12.04.16	Added bending, crushing dimensions	KJ	<i>[Signature]</i>



Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
Tel: 613 632 9577
Fax: 613 632 1053

PURCHASE ORDER

Purchase Order ID **PO27806**

Purchase Order Date 3/17/2015

PO Print Date 3/17/2015

Page Number 2 of 2

Order From :
SKYSERVICE
6120 MIDFIELD ROAD
MISSISSAUGA, ONTARIO L5P 1B1
CANADA

VC-SKY001

Ship To : DART AEROSPACE LTD
1270 ABERDEEN
HAWKESBURY, ON K6A 1K7
CANADA

Contact Name

Vendor Phone 905-678-5636

Ship To Contact

Ship To Phone

Ship Via: Delivered

Ship Acct:

Buyer

Customer POID

Customer Tax #

Terms

Currency

FOB

Chantal Lavoie

10127-2607

Net 30

CAD

FCA - (Free Carrier)

3	127626	D412-664-209 CROSSTUBE	3/17/2015	1.00	\$133.33	\$133.33
			Yes 3/17/2015			

LIQUID PENETRANT INSPECTION AS PER QSI 038 OR
LPI AS PER ASTM 1417 LEVEL 2

Line Total: \$133.33

4	126548	D407-667-205 CROSSTUBE	3/17/2015	1.00	\$133.33	\$133.33
			Yes 3/17/2015			

LIQUID PENETRANT INSPECTION AS PER QSI 038 OR
LPI AS PER ASTM 1417 LEVEL 2

Line Total: \$133.33

PO Total: \$400.00

Note: Terms & Condition of Purchasing(Suppliers) and Procurement Quality Clauses are an integral part of our AS9100 requirements. To learn in detail, please visit www.dartaerospace.com for further explanation.

Change Nbr: 2

Change Date: 3/17/2015

**skyservice****Work Order Traveler**
Sky Service F.B.O. Inc.

DOT APP 53-89 / EASA 145.7142 / BDA AMO 385

WO #: MWO23940	Customer: Dart Aerospace Ltd.	Dept: NDT YUL	Reference: PO27806
Descr:	PN:	S/N:	Qty: 1
Make:	Model:	Reg:	A/C S/N:
TSN:	CSN:	TSO:	
Task: UNSCHEDULED			Sequence: 1

Work Required:

CARRY OUT NDT (LIQUID PENETRANT) ON THE FOLLOWING THREE CROSSTUBES:

ID# D412-664-209 AFT CROSSTUBES


1-WORK ORDER ID 127626 2-WORK ORDER ID 130355

ID# D407-667-205 AFT CROSSTUBE3-WORK ORDER ID 85315 126548

SP15-03-17.

Action Taken:						Date:	Initial/Stamp:
LIQUID PENETRANT INSPECTION CARRIED OUT ON ITEMS LISTED ABOVE (ITEMS 1-3) AS PER ASTM1417M-13						17 MAR 2015	
NO CRACK FOUND							
PEN.(ZL-56, B#10A042), CLEAN(SKC-S, B#12F02K), DEV.(SKD-S2, B#12B05K)							
Description	Location	P/N	Qty	Batch	S/N Off	S/N On	

I certified that the maintenance described above has been performed in accordance with the applicable standard of airworthiness.

Signature: 	ACA/SCA Stamp 	Date: 17 MAR 2015
Name: CHRISTIAN BRIEN		

Order ID 85315

Time-05-12 3:36:34 PM

85315

Page 1

Item ID: D407-667-205

Accept

N900040100

Setup Start *NS1*

Revision ID: ..

Item Name: Crossfube Aft

Stop *NS2*

Start Date: 05/06/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 19/06/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: MLJ Date: 12/06/05

Tooling:

Date:

Run Start *NR1*

QC:

Date:

SPC (Y/N):

Date:

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D407-667-245

Rev F/DEO

100

100

DC

Document Control

DOCUMENT CONTROL

Memo

Photocopy bluefile and create labels as per PPP D407-667-205 CHG007

0.00

0.00

DAS
16
2-83

12/4/27

008

MLJ 12-7-26

110

110

Packaging

Packaging

Pick Kit

~~Packaging~~

Memo

0.00

0.00

DP

12-7-17

120

120

CNC Bend 1

CNC Delta 100 Bender

BENDING MACHINE - CROSSTUBES

Memo

1-Bend tube as per Dwg D407-667-245 using CNC bender program 407 Aft and Folio 21

0.00

0.00

DP

12-7-17

Picklist Print

June-05-12 3:36:38 PM

Page 1

Work Order ID: 85315

85315

Parent Item: D407-667-205

D407-667-205

Parent Item Name: Crosstube Aft

Start Date: 05/06/2012

Required Date: 19/06/2012

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:C 05.09.02 Add holes for compatibility with Bell SkidtubesKJ/JLM
IPP Rev:D Added Magnobond,Rubber Cushion & Clamps 07-02-19
JLM

****CHANGE TO CHG 005 - IF USING D2894-1 B35578 OR GREATER****

IPP Rev:E 08-05-22 add comment in seq. 6 and QC15 and QC5 DD verified by:EC

IPP Rev:F 08-06-12 add comment in seq. 24 DD verified by:EC

IPP Rev:G 08-08-19 revE as per dwg DD verified by:EC

IPP Rev H 09.01.06 ECN 08-562 EC verified by:DD IPP Rev:I

10.04.07 revise route seq. in bom DD verified by:JLM IPP Rev J 11.04.26

removed abrasion strip ecn 11-551 EC verified

by:DD

IPP REV:K

11.10.03 DEO D407-667-245-F-2 DD verf:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D407-667-205TRN		Manufactured	No			110	Each	0.0000	1	1			
D407-667-205TRN													
Crosstube Turning Detail													
AN960JD516	NAS1149D0563J	Purchased	No			230	Each	0.0000	18	18			
AN960.ID516													
Washer													
D2873-043		Manufactured	No			230	Each	40.0000	2	2			
D2873-043													
Nut Plate Assembly													

Location

Loc Qty

Loc Code

LG052

40

72644

2

82949

38

2

Work Order ID 84103

May-30-12 3:56:32 PM

84103

Page 1

Item ID: D407-667-205TRN

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Crosstube Turning Detail

Start Date: 03/05/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 17/05/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: MLJ

Date: 12/05/31

Tooling:

Date:

Run Start *NR1*

QC:

Date:

SPC (Y/N):

Date:

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D407-667-245

Rev F

100

0.00

100

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DT8531 on both ends as per Folio FA248

2-Turn first side as per Folio FA248

3-Blend transition lines only, **do not sand whole tube**:

FOLIO REV: AA

DWG REV: 1

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

110

QC1- Inspect dimensions to dimension sheet

0.00

110

QC

Memo

0.00

Quality Control

MM, L
12/06/27

MM, L
12/06/27

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 84103

May-30-12 3:56:32 PM

84103

Page 2

Item ID: D407-667-205TRN

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Turning Detail

Stop ***NS2***

Start Date: 03/05/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 17/05/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120		0.00							
120	MORI SEIKI CNC LATHE LARGE								
Mori Seiki	Memo	0.00							
Mori Seiki CNC Lathe Large	1-Turn second side as per Folio FA248								
	2-Blend transition lines only, **do not sand whole tube**: *Use mill bastard file, brush file repeatedly with file card. *Do not use sandpaper coarser than 320 grit.								
	FOLIO REV: <u>AA</u>								
	DWG REV: <u>F</u>								
	3-Remove sand and plugs								
	4-Scribe part # and batch # using vibrating stylus as per Dwg D407-667-245								
	Inside of Cuff(Donot engrave on outside of tube)								
130	QC1- Inspect dimensions to dimension sheet	0.00							
130									
QC	Memo	0.00							
Quality Control									

1 ϕ KE 12-6-28

1 ϕ KE 12-6-28

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 84103

May-30-12 3:56:32 PM

84103

Page 3

Item ID: D407-667-205TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Turning Detail

Stop ***NS2***

Start Date: 03/05/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 17/05/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

140

QC8- Inspect parts - second check

0.00

140

QC

Memo

0.00

Quality Control

DP

12-7-4

145

0.00

145

Crosstubes

Memo

0.00

Crosstubes

Grind off circumferential machining marks longitudinally.

Rm

12-7-9

150

Crosstubes Chemical Conversion

0.00

150

HandFXtube

Memo

0.00

Hand Finishing Crosstubes

Ensure no sand is in the tube before alodine.

u sad etc pressure wash

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 84103

May-30-12 3:56:32 PM

84103

Page 4

Item ID: D407-667-205TRN

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 03/05/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 17/05/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160	QC 5 Inspect Chemical Conversion Coat	0.00							
160									
QC	Memo	0.00							
Quality Control									
170	Packaging	0.00							
170									
Packaging	Memo	0.00							
Packaging	Identify and stock in kanban rackLocation: <u>LG</u>								
180	QC21- Final Inspection - Work Order Release	0.00							
180									
QC	Memo	0.00							
Quality Control									

DP 12-7-13

JW 12-7-13

MLJ 12/07/13

MLJ 12/07/13

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

May-30-12 3:56:35 PM

Page 1

Work Order ID: 84103

84103

Parent Item: D407-667-205TRN

D407-667-205TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 03/05/2012

Required Date: 17/05/2012

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A 08-03-06 new issue DD verified by:ec
IPP Rev B 08:04.02 Removed polish EC verified by: DD
IPP Rev:C 08-08-19 revE as per dwg DD verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6011-115		Manufactured	No			120	Each	45.0000	1	1			

D6011-115

Crosstube Material

**

Location

Loc Qty

Loc Code

FG

26

69802

26

LG

19

65180

1

67798

18

man-L 12/06/26

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order:	84103
Description: Crosstube Assembly	Part Number:	D407-667-245
Inspection Dwg: D407-667-245 Rev: F		Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☐ Prototype

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.490	+0.005/-0.000	2.494	/		VERN	CNC-OB
	1.832	+0.005/-0.000	1.835	/			
	1.838	+0.005/-0.000	1.842	/			
	1.892	+0.005/-0.000	1.897	/			
	2.052	+0.005/-0.000	2.056	/			
	2.206	+0.005/-0.000	2.211	/			
	2.521	+0.005/-0.000	2.525	/			
	2.633	+0.005/-0.000	2.637	/			
	4.10	+/-0.030	4.10	/			
	4.978	+/-0.030	4.978	/			
	2.040	+0.000/-0.010	2.032	/			
	0.125	+/-0.010	.125	/			
	R0.063	+/-0.010	.063	/		RG	
	R0.500	+/-0.010	.500	/		RG	
SIDE B	2.490	+0.005/-0.000	2.494	/		VERN	CNC-OB
	1.832	+0.005/-0.000	1.836	/			
	1.838	+0.005/-0.000	1.843	/			
	1.892	+0.005/-0.000	1.895	/			
	2.052	+0.005/-0.000	2.056	/			
	2.206	+0.005/-0.000	2.211	/			
	2.521	+0.005/-0.000	2.525	/			
	2.633	+0.005/-0.000	2.636	/			
	4.10	+/-0.030	4.10	/			
	4.978	+/-0.030	4.978	/			
	2.040	+0.000/-0.010	2.032	/			
	0.125	+/-0.010	.125	/		VERN	
	R0.063	+/-0.010	.063	/		RG	
	R0.500	+/-0.010				RG	
	112.91	+/-0.020	112.91	/		Type	LG-25

Measured by:	Audited by:	Prototype Approval:	N/A
Date: 12/06/26	Date: 12-7-4	Date:	N/A

Rev	Date	Change	Revised by	Approved
A	04.04.21	New Issue (P/O D407-667-205)	KJ/RF	
B	06.03.09	Dwg Rev updated	KJ/JLM	
C	06.03.30	Tolerance revised for 4.978 dimension	KJ/JLM	
D	07.02.19	Dwg Rev updated	KJ/JLM	
E	09.05.20	Dwg Rev updated	KJ	

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Item	QTY -245	PART NUMBER	DESCRIPTION
1	X	D407-667-245	CROSSTUBE ASSEMBLY (407 HIGH AFT)
2	1	D6011-115	CROSSTUBE
3	2	D2856-400-773	ABRASION STRIP
4	2	D2873-043	NUT PLATE
5	2	D2873-045	NUT PLATE
6	1	D2894-1	SUPPORT
7	2	D3190-1	CHAFING SHIELD
8	2	D3595-063-430	RUBBER CUSHION
9	14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
10	4	MS21920-22	CLAMP
11	2	MS21920-25	CLAMP (OR MS21920-24)
12	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947- 100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6011-115
FINISHED LENGTH = 112.91±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D407-667-245" AND BATCH NUMBER ON
INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 27.7 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY. TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 6 PASSES. MAXIMUM TUBE FLATTENING DUE TO
BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2894-1 CENTER SUPPORT USING A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND
6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO
PACKAGING.
- 13) INSTALL MS21920-25 CLAMPS WITH D3595-063-430 RUBBER CUSHIONS TO SECURE D2894-1
SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE CROSSTUBE
SUPPORT.
NOTE: MS21920-24 CLAMPS CAN BE USED TO ACCOMMODATE VARYING DIAMETERS.
ENSURE THERE IS A MINIMUM OF 1.5 THREADS IN SAFETY ON THE NUTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) INSTALL D2856-400-773 ABRASION STRIP WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF
CROSSTUBE, PER QSI 035.
- 16) INSTALL D3190-1 CHAFING SHIELDS SO THAT OVERLAP IS ON BOTTOM SIDE OF CROSSTUBE
OPPOSITE D2894-1 SUPPORT.
- 17) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN
SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY
RETURNED
ENGINEERING
UNCONTROLLED
SUBJECT TO AMENDMENT

WORK IN PROGRESS

NO. 84103 MCT
12/05/31

@DEO ATTACHED

RELEASED
08/11/06

F	REFORMAT NOTES TO NEW STANDARDS (ZN B8-1); RELOCATED FLAG # 6 (ZN A8-3) PER NCR 210; REMOVED REF. & ADD TOLERANCES (ZN C8-3, C4-3 & D2-3)	RF	08.11.06
E	8.02 AND 8.53 WERE 8.40 AND 8.90 (ZN 05-2); REORGANIZED VIEWS AND REFORMATED DRAWING TO CURRENT STANDARDS. REASONS: CLAMPS MOVED 0.375 TOWARD CL TO ELIMINATE INTERFERENCE WITH AIRCRAFT MOUNTS. REFERENCE: FAR808-21 AND ECN#1225	MB	08.07.24
D	ADD VIEW FOR OEM SKID HOLES, ROTATE ORIENTATION OF CLAMPS SECTION F-F, REMOVE .551 ABRASION STRIP, ADD MAGNOBOND 6398, ADD CUSHION	PH	07.02.07
C	ADD HOLES AND NUT PLATES FOR COMPATIBILITY WITH BHT/AA SKIDTUBES	PH	05.07.26
B	ADD CHAFING SHIELD	CP	03.05.21
A	NEW ISSUE	CP	02.05.13
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF	DRAWING NO.	REV. F
CHECKED	RF	D407-667-245	SHEET 1 OF 4
MFG. APPR.	RF	TITLE	SCALE
APPROVED	RF	CROSSTUBE ASSY (407 HIGH AFT)	NTS
DE APPR.	RF	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PROPRIETARY AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR DISCLOSED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	
DATE	08.11.06		






Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

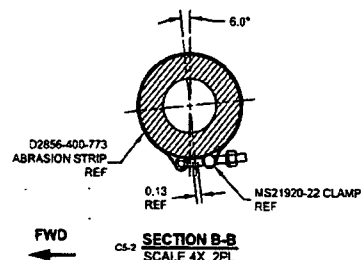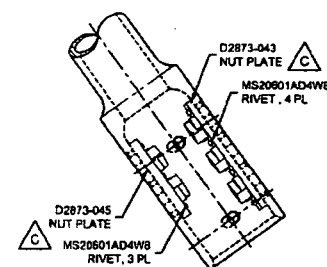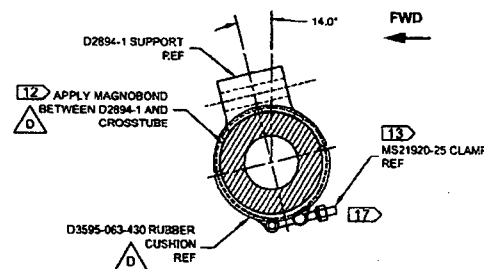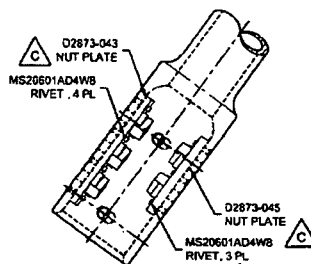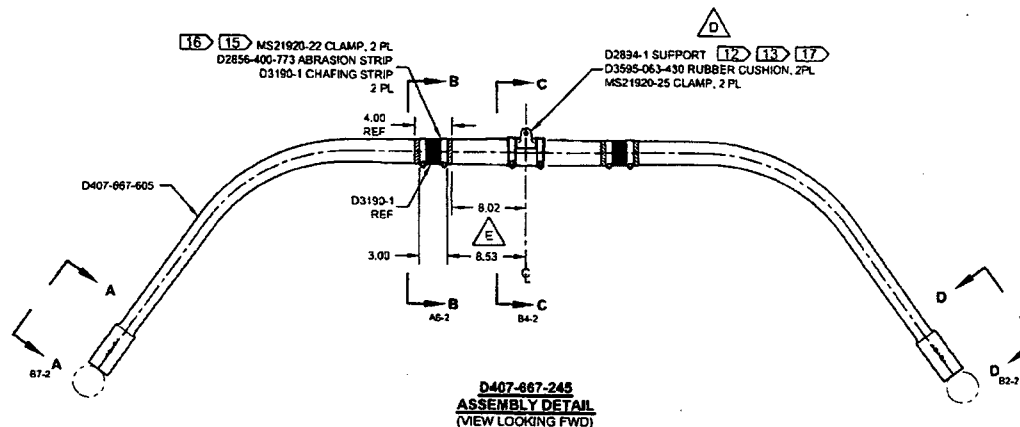

2 DEO ATTACHED
RELEASED
08/11/06

DESIGN	4	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	4	DRAWING NO.	REV. F
MFG. APPR.	4	D407-667-245	SHEET 2 OF 4
APPROVED	4	TITLE	SCALE
DE APPR.	4	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	08.11.06	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRINTED AND CONTROLLED, AND IS SUPPLIED ON THE EXPRESSED CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

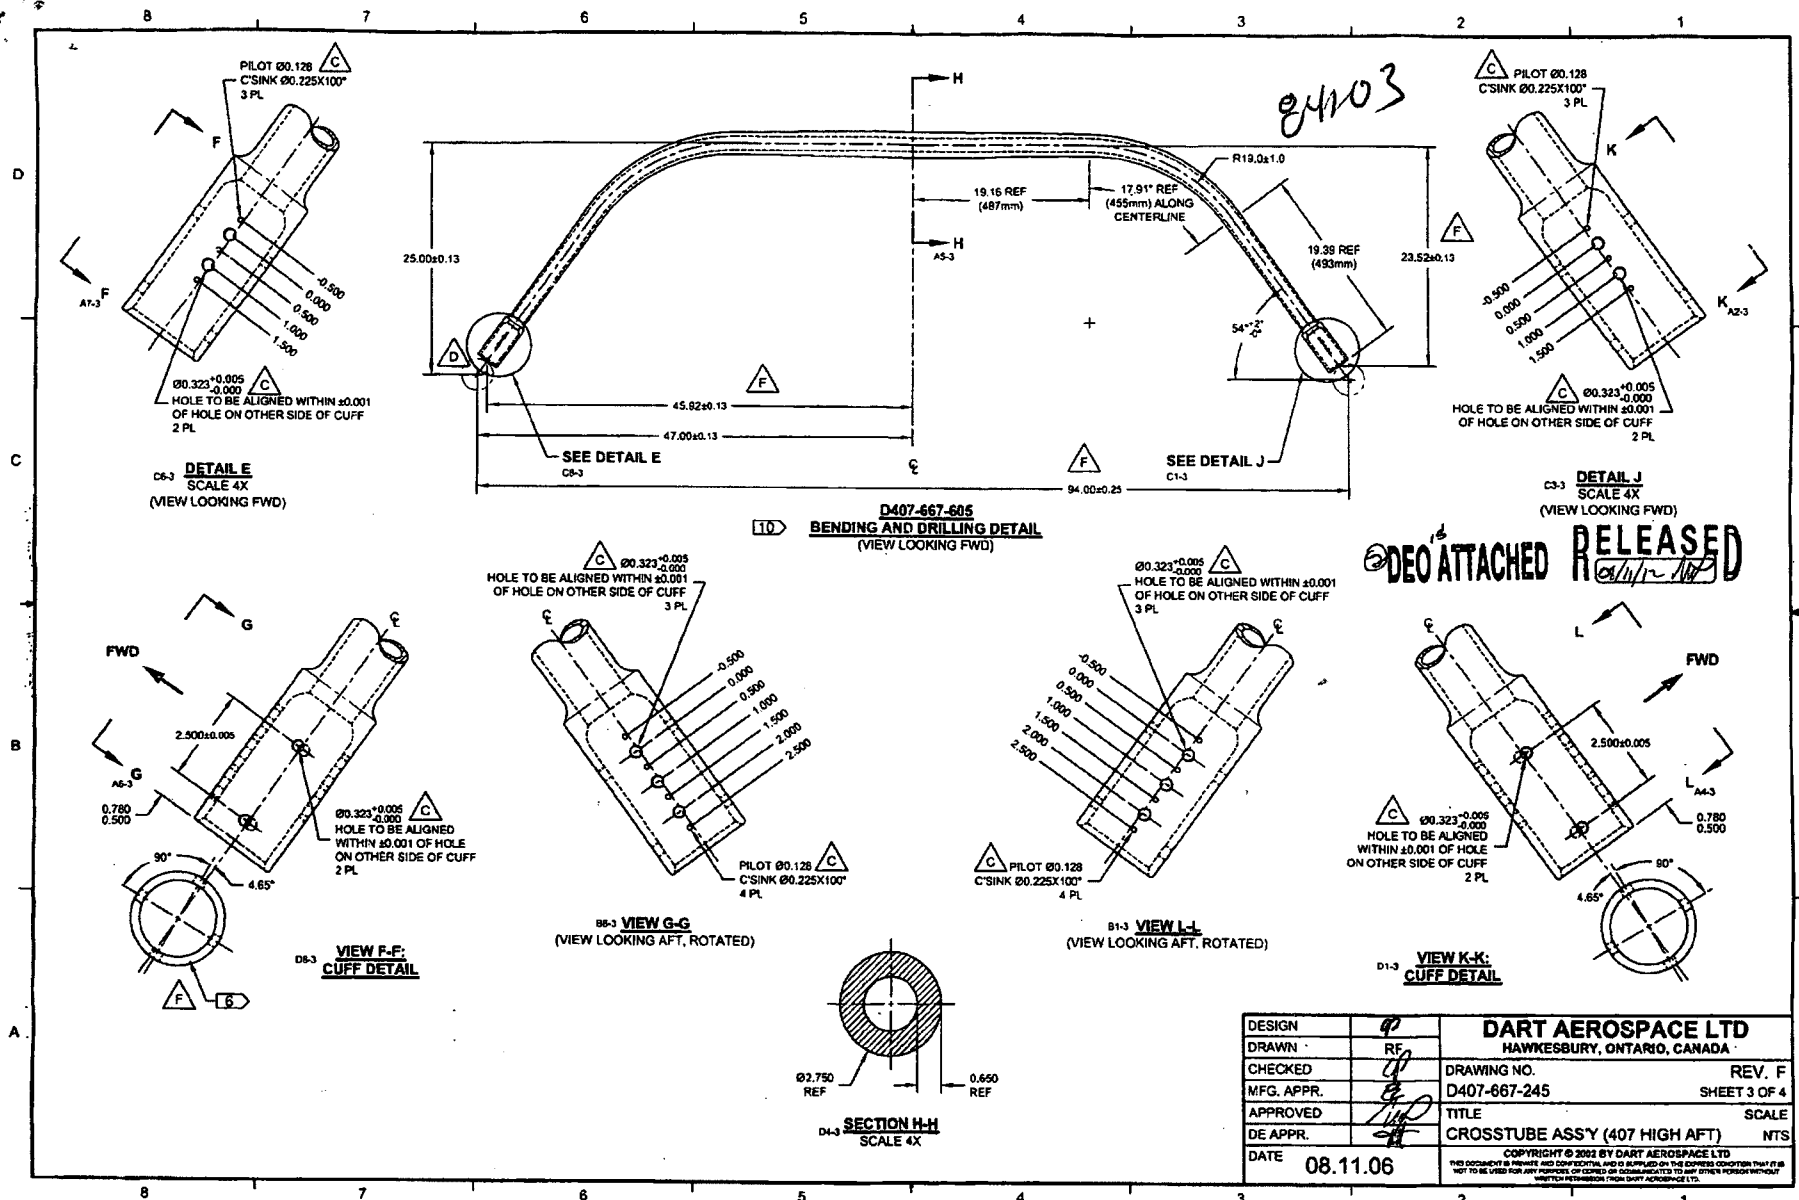

DEO ATTACHED RELEASE

DESIGN	RF	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. F
MFG. APPR.	RF	D407-667-245	SHEET 3 OF 4
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	CROSSTUBE ASSY (407 HIGH AFT)	NTS
DATE	08.11.06	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS UNCLASSIFIED AND IS RELEASED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OF COPIES OR REPRODUCTION TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


SEE DETAIL M
A7-4

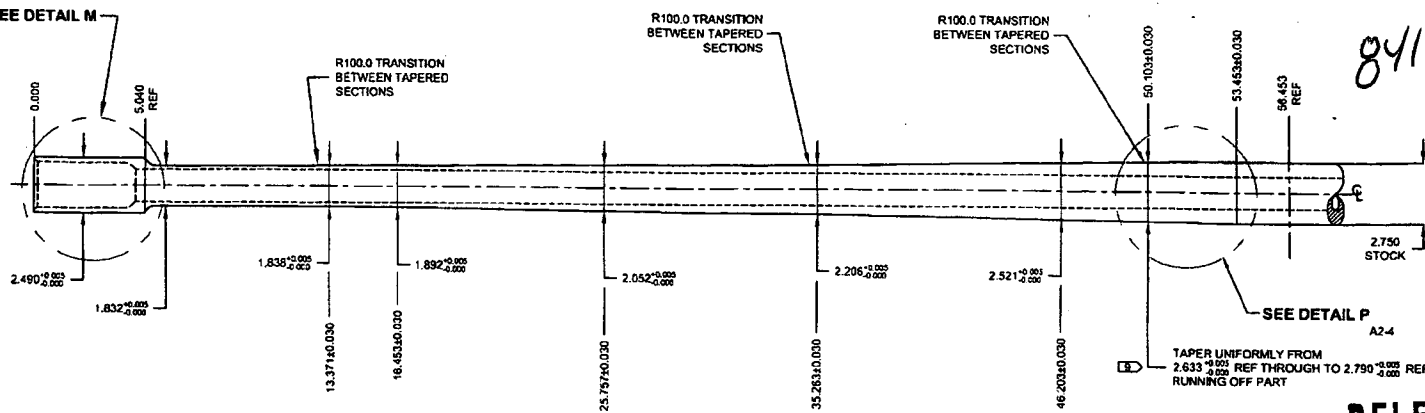


D407-667-245 MACHINING DETAIL

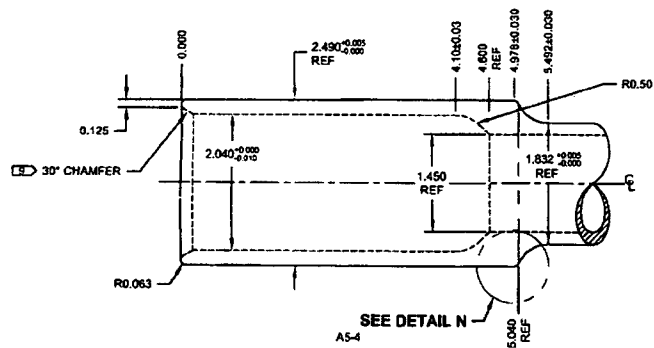

DETAIL M: CROSSTUBE CUFF
SCALE 3X

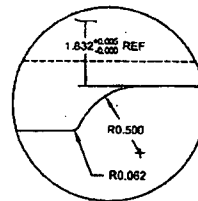

DETAIL N: CUFF TRANSITION
SCALE 2X

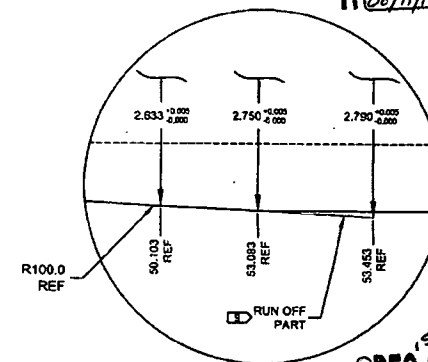

DETAIL P: TAPER RUN-OFF
NOT TO SCALE

RELEASED
08/11/12 JWD

DEO'S ATTACHED

DESIGN	40	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	40	DRAWING NO.	REV. F
MFG. APPR.	40	D407-667-245	SHEET 4 OF 4
APPROVED	40	TITLE	SCALE
DE APPR.	40	CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	08.11.06	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRELIMINARY AND NOT TO BE USED FOR ANY PURPOSE OR ON ANY BASIS OR FOR ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DRAWING NO. D407-667-245	TITLE CROSSTUBE ASSY (407 HIGH AFT)	REV. F	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D407-667-245-F-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN <i>[Signature]</i>	CHECKED <i>[Signature]</i>	MFG. APPR. <i>[Signature]</i>	APPROVED <i>[Signature]</i>		DE APPR. <i>[Signature]</i>		
DATE 11.04.08	DATE 11.04.12	DATE 11.04.12	DATE 11.04.12		DATE 11.04.12		

PURPOSE:

REMOVED ABRASION STRIP IN FAVOR OF A THIN LAYER OF PROSEAL 890.

CHANGE:

PARTS LIST IS AMENDED AS FOLLOWS:

IS:

Item	Qty -245	Part Number	Description
3	0	D2856-400-773	ABRASION STRIP

WAS:

3	2	D2856-400-773	ABRASION STRIP
---	---	---------------	----------------

NOTES 2 AND 16, SHEET 1 ARE AMENDED AS FOLLOWS:

IS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA) AND
PAINT OUTSIDE PER DART QSI 005 4.2
REMOVE MASKING AND APPLY CLEAR COAT
- 15) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3190-1
CHAFING SHIELDS AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL
PROSEALED D3190-1 CHAFING SHIELDS ONTO CROSSTUBE BY APPLYING A THIN COAT
OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.

WAS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 15) INSTALL D2856-400-773 ABRASION STRIP WITH A 0.13 REF GAP ON BOTTOM SIDE OF
CROSSTUBE PER QSI 035.

84103
RELEASED
2011-04-18
[Signature]

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


DRAWING NO. D407-667-245	TITLE CROSSTUBE ASSY (407 HIGH AFT)	REV. F	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D407-667-245-F.1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED <i>up</i>	MFG. APPR. <i>E</i>	APPROVED <i>WP</i>	DE APPR. <i>H</i>		
DATE 11.04.08	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12	DATE 11.04.12		

IS:

WAS:

RELEASED
2011-04-10

84103

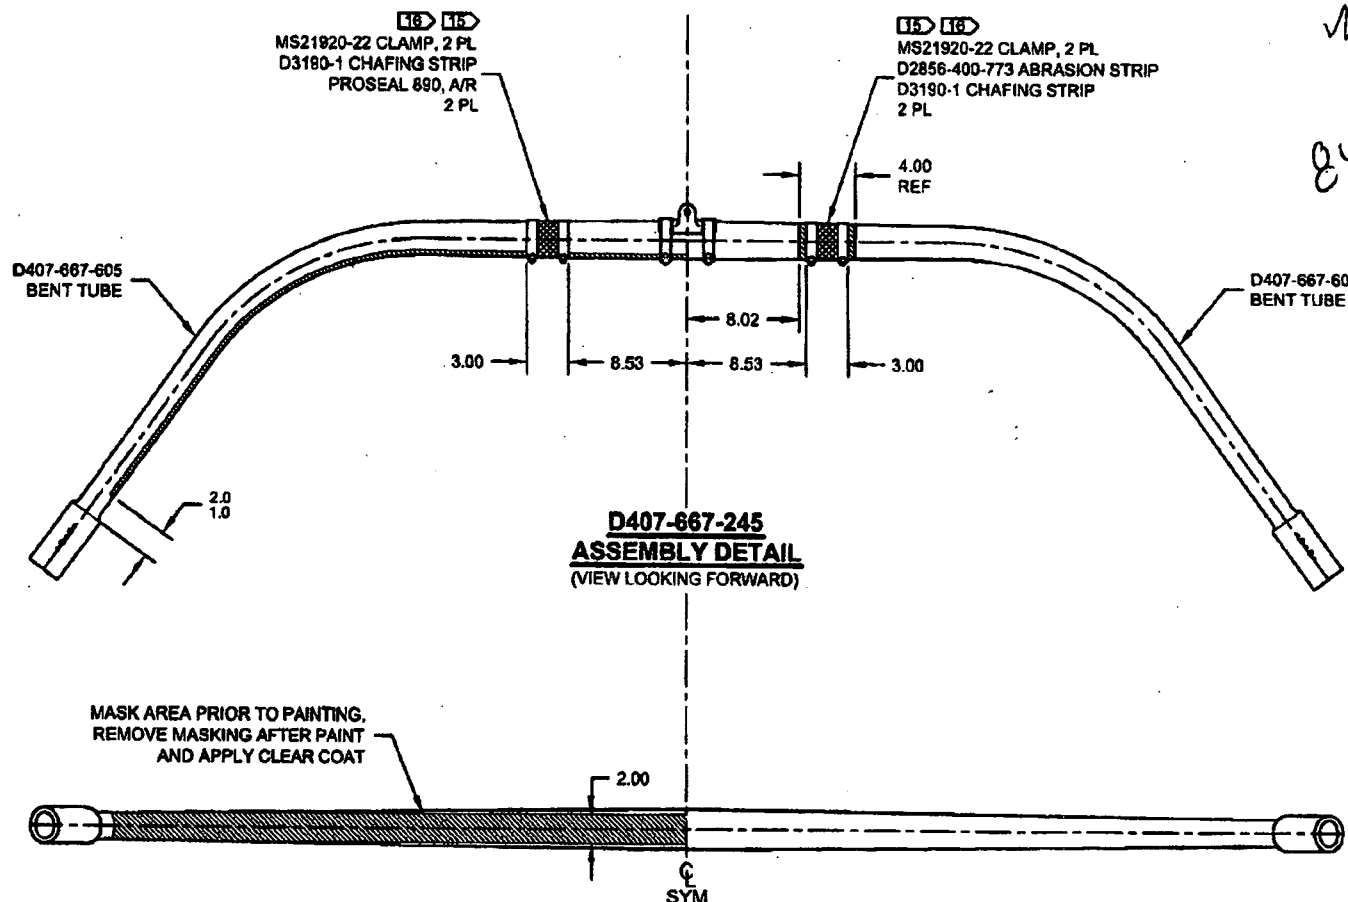

COPYRIGHT © 2011 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DRAWING NO. D407-667-245	TITLE CROSSTUBE ASS'Y (407 HIGH AFT)	REV. F	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D407-667-245-F-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>QD</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>BE</i>	APPROVED <i>MP</i>	DE APPR. <i>MP</i>			
DATE 11.09.07	DATE 11.09.15	DATE 11.09.19	DATE 11.09.19	DATE 11.09.19			

PURPOSE:

REPLACE MAGNOBOND WITH 3M DP460 SCOTCH-WELD EPOXY ADHESIVE

CHANGE:

IS:

Item	Qty -245	Part Number	Description
12	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD

WAS:

12	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
----	-----	----------------	---

NOTE 12 & 17, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) INSTALL D2894-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015. LET CURE FOR 24 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVE HAS CURED FOR 24 HOURS.

WAS:

- 12) INSTALL D2894-1 CENTER SUPPORT USING A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-09-29

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order: <u>84103</u>
Description: Crosstube Assembly	Part Number: <u>D407-667-245</u>
Inspection Dwg: D407-667-245 Rev: F	Page 2 of 2

WALL THICKNESS MEASUREMENT

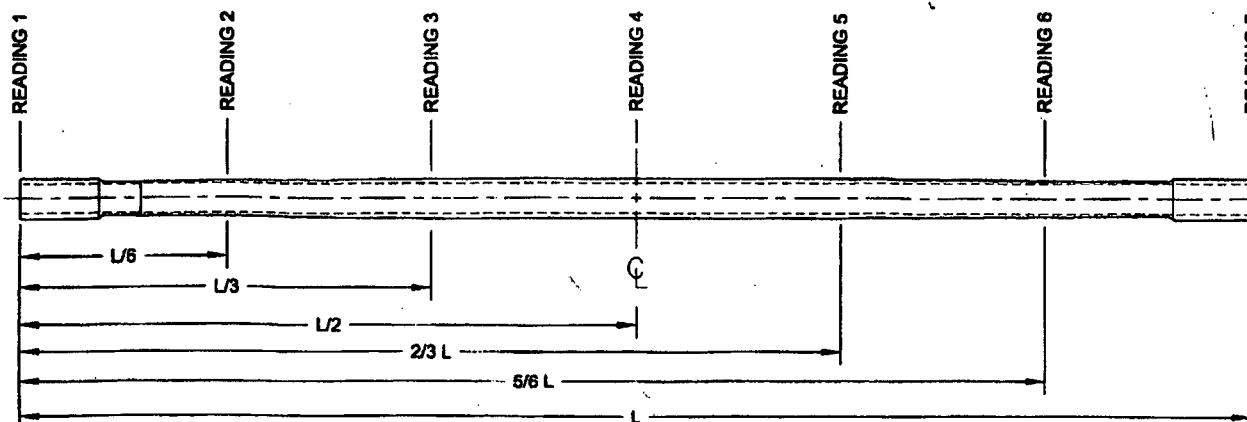

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.291	.236 ^{.283}	.235	.286	.048	0.075"
READING 2 L=	.259	.405 ^{.236}	.237	.267	.031	
READING 3 L=	.422	.665 ^{.405}	.414	.434	.029	
READING 4 L=	.659	.440 ^{.665}	.674	.673	.015	
READING 5 L=	.393	.249 ^{.440}	.447	.427	.054	
READING 6 L=	.224	.23 ^{.249}	.273	.255	.049	
READING 7 L=	.232	.231	.233	.231	.002	

Calibration Result

Actual Block Thickness: 100-560

Sitiescan 250 Measured Thickness: 100-500

Measured by: <u>KC</u>	Audited by: <u>DP</u>	Preliminary Approval:
Date: <u>12-7-04</u>	Date: <u>12-7-4</u>	Date:

Rev	Date	Change	Revised by	Approved
A	04.04.21	New Issue (P/O D407-667-205)	KJ/RF	
B	06.03.09	Dwg Rev updated	KJ/JLM	
C	06.03.30	Tolerance revised for 4 .78 dimension	KJ/JLM	
D	07.02.19	Dwg Rev updated	KJ/JLM	
E	09.05.20	Dwg Rev updated	KJ	
F	12.06.04	Wall thickness form added	KJ	

Table 5-7: D407-667-105 and D407-667-205 Crosstube Spread Limits

Dimension	Spread Limits (inches)	Spread Limits (mm)
A	45.40 to 46.90	1153 to 1191
B	45.40 to 46.90	1153 to 1191
C	90.80 to 93.80	2306 to 2382

- 5.3.9 Inspect all areas of the crosstube for suitability of the paint finish. Touch up affected areas with chemical film material (Alodine 1200 or 1201) per MIL-C-5541, one coat of MIL-P-85582 or MIL-P-23377 primer, and 2-3 coats of MIL-C-85285 polyurethane paint to match original finish.

For D407-667-205 High Aft Crosstubes that are being refinished, an inspection window should be incorporated into the underside of the crosstube to facilitate inspection as follows:

- 1) Apply chemical conversion film material (Alodine 1200 or 1201) per MIL-C-5541 and one coat of MIL-P-85582 or MIL-P-23377 primer.
- 2) Mask underside of crosstube as per hatched area shown in Figure 5-8.
- 3) Paint outside surfaces of crosstube by applying 2-3 coats of MIL-C-85285 polyurethane paint to match original finish.
- 4) Apply clear coat on inspection window (hatched area).


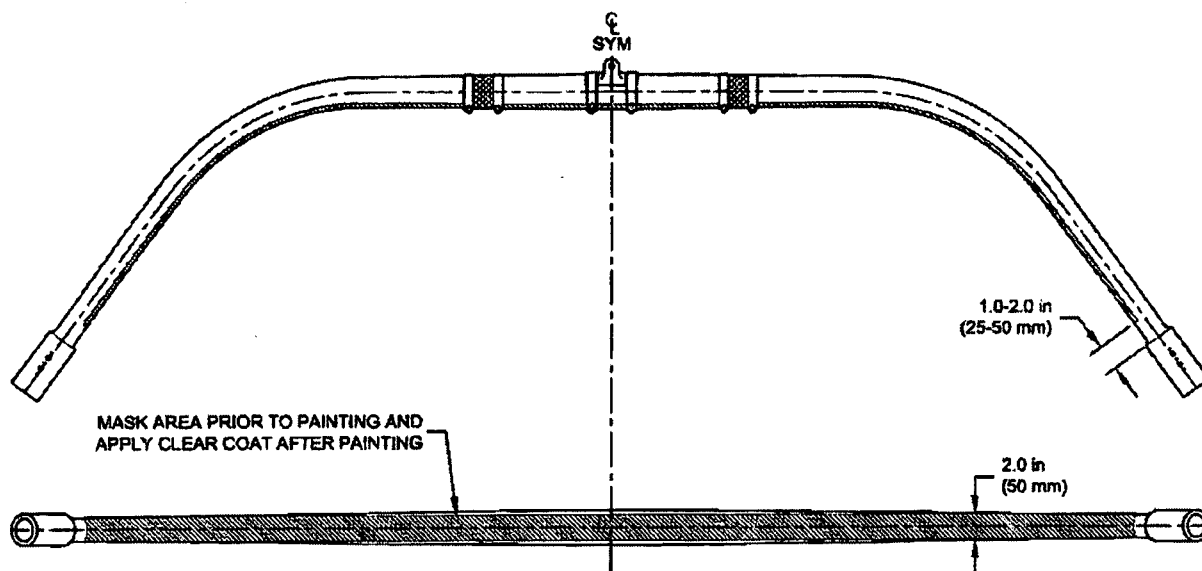


Figure 5-8: Inspection Window on D407-667-205 Crosstube

- 5.3.10 Replace all excessively damaged or unserviceable parts per chapter 32 of these Instructions.

DART AEROSPACE LTD		Work Order:
Description: Crosstube Assembly		Part Number:
Inspection Dwg:	Rev:	Page 2 of 2

WALL THICKNESS MEASUREMENT

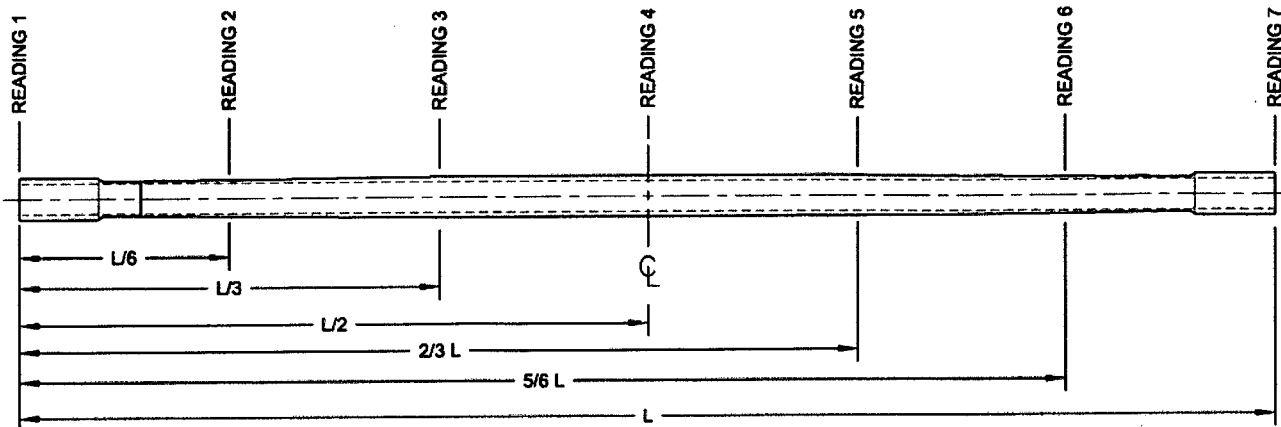

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.235	.234	.236	.236	.006	
READING 2 L= 19	.229	.253	.266	.239	.037	
READING 3 L= 37	.374	.404	.424	.388	.050	
READING 4 L= 56	.641	.638	.654	.653	.016	
READING 5 L= 75	.433	.414	.431	.460	-.046	
READING 6 L= 93	.254	.264	.301	.293	.008	
READING 7 L= 112	.233	.230	.234	.232	.004	


Calibration Result

Actual Block Thickness: 100 - 750


Sitescan 250 Measured Thickness: 100 - 750

Measured by: <u>man L</u>	Audited by:	Preliminary Approval:
Date: <u>15/03/10</u>	Date:	Date:


Rev	Date	Change	Revised by	Approved
B	10.04.14	Added preliminary approval	KJ	
C	12.06.01	Wall thickness form added	KJ	

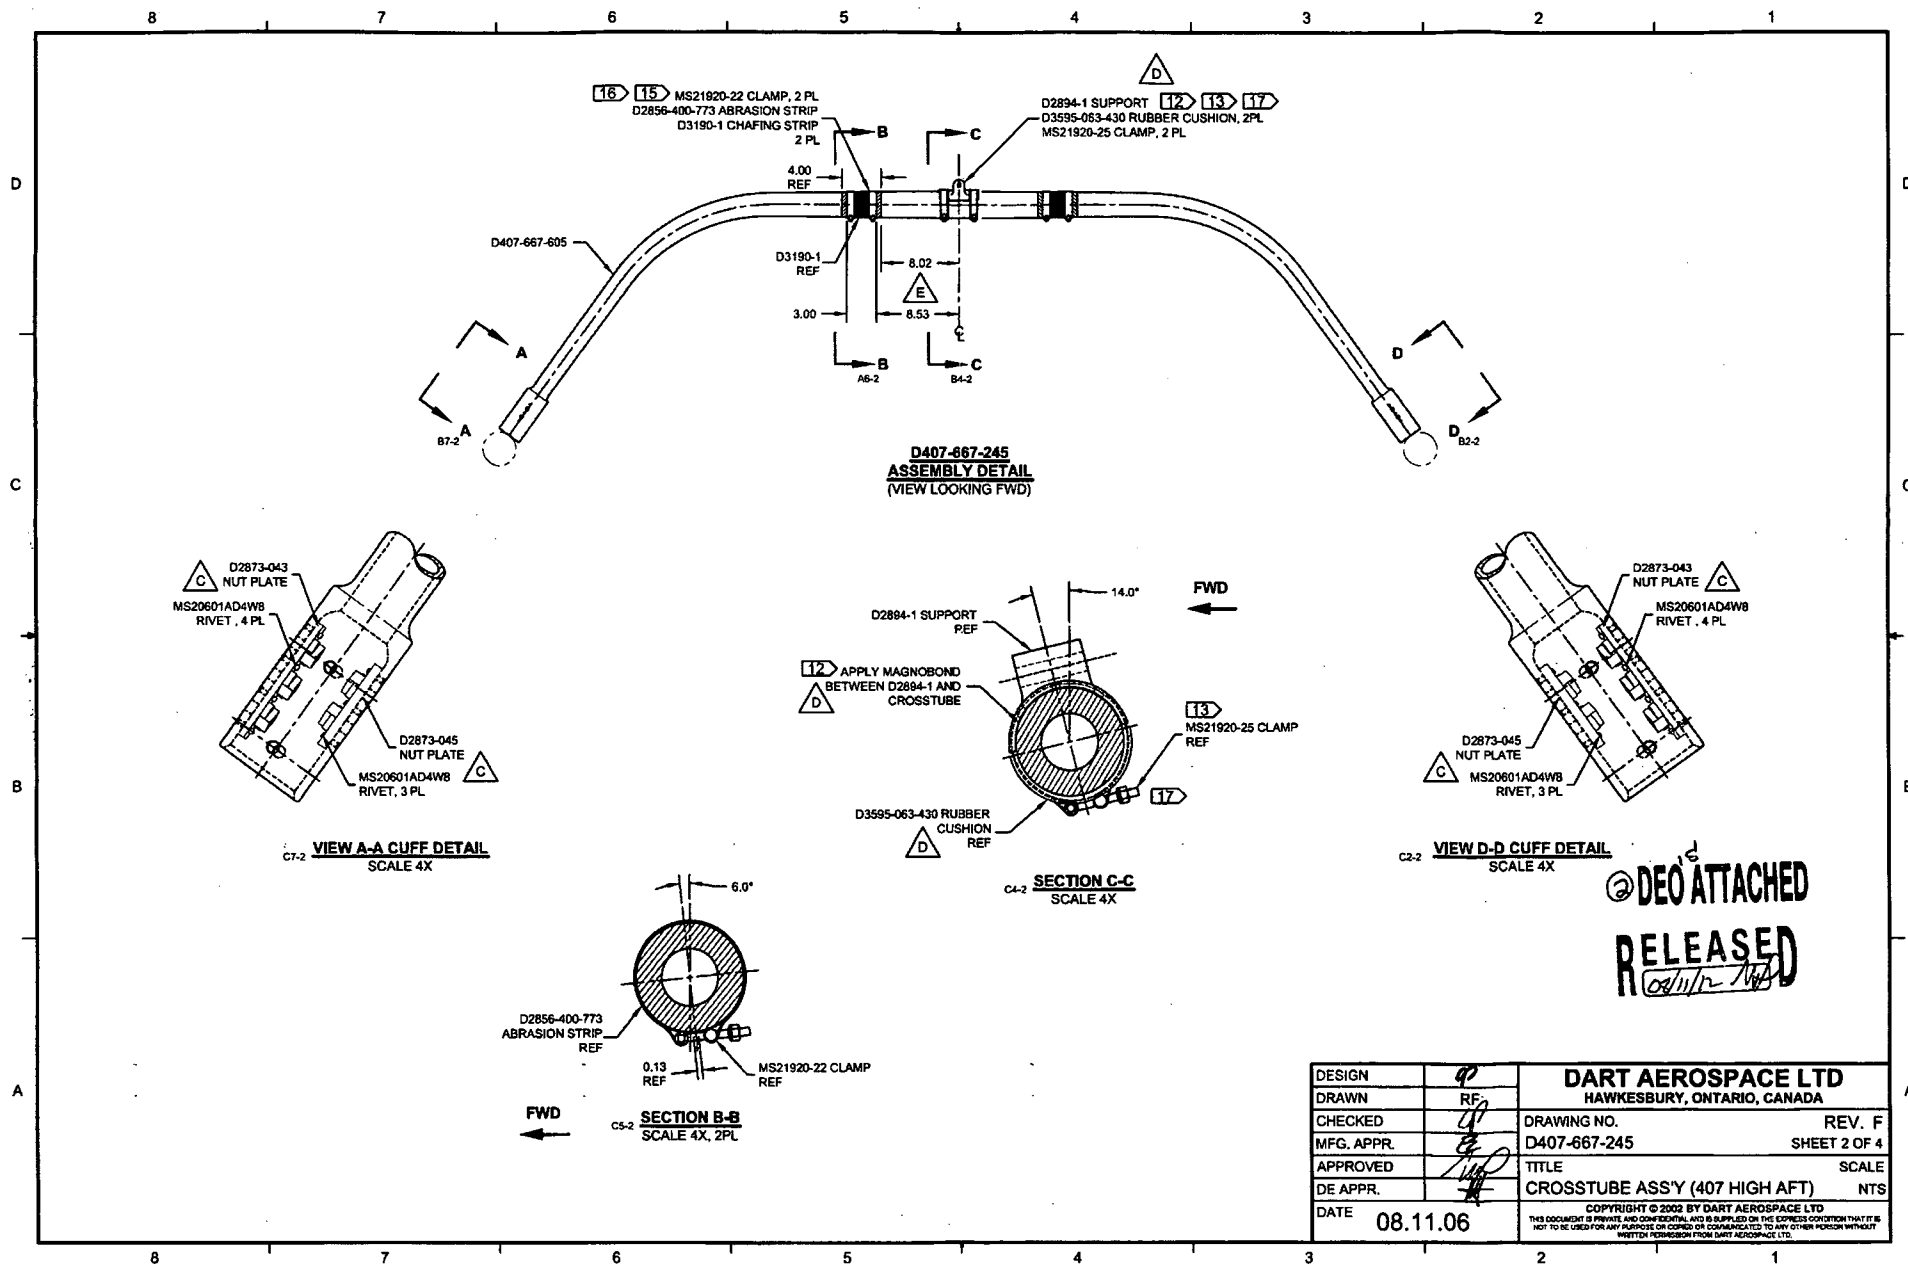

DESIGN	90	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	4	DRAWING NO.	REV. F
MFG. APPR.	8	D407-667-245	SHEET 2 OF 4
APPROVED	140	TITLE	SCALE
DE APPR.		CROSSTUBE ASS'Y (407 HIGH AFT)	NTS
DATE	08.11.06	COPYRIGHT © 2003 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR DISSEMINATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

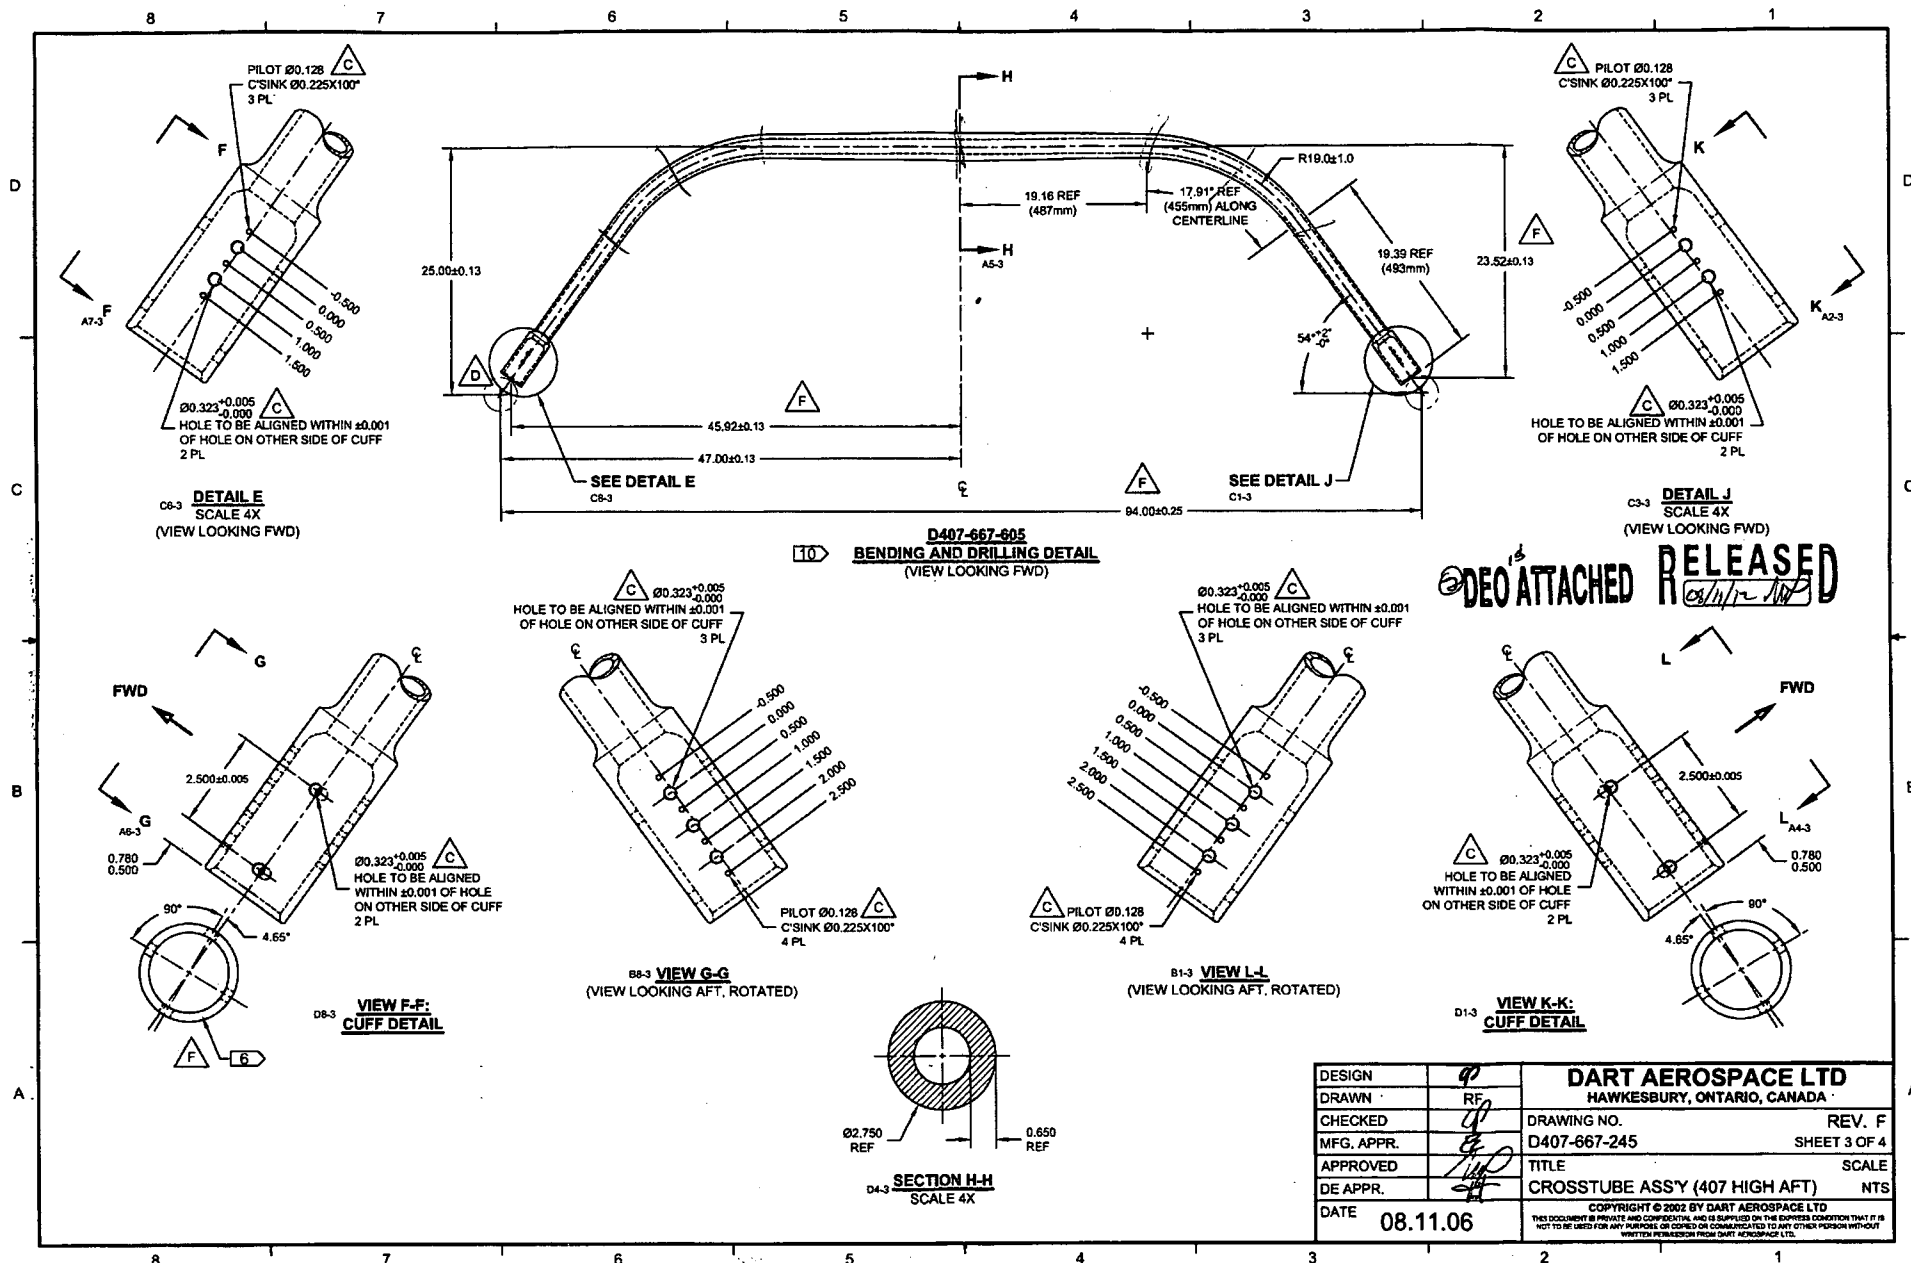

DESIGN	47	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	47	DRAWING NO.	REV. F
MFG. APPR.	47	D407-667-245	SHEET 3 OF 4
APPROVED	47	TITLE	SCALE
DE APPR.	47	CROSSTUBE ASSY (407 HIGH AFT)	NTS
DATE	08.11.06	COPYRIGHT © 2002 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

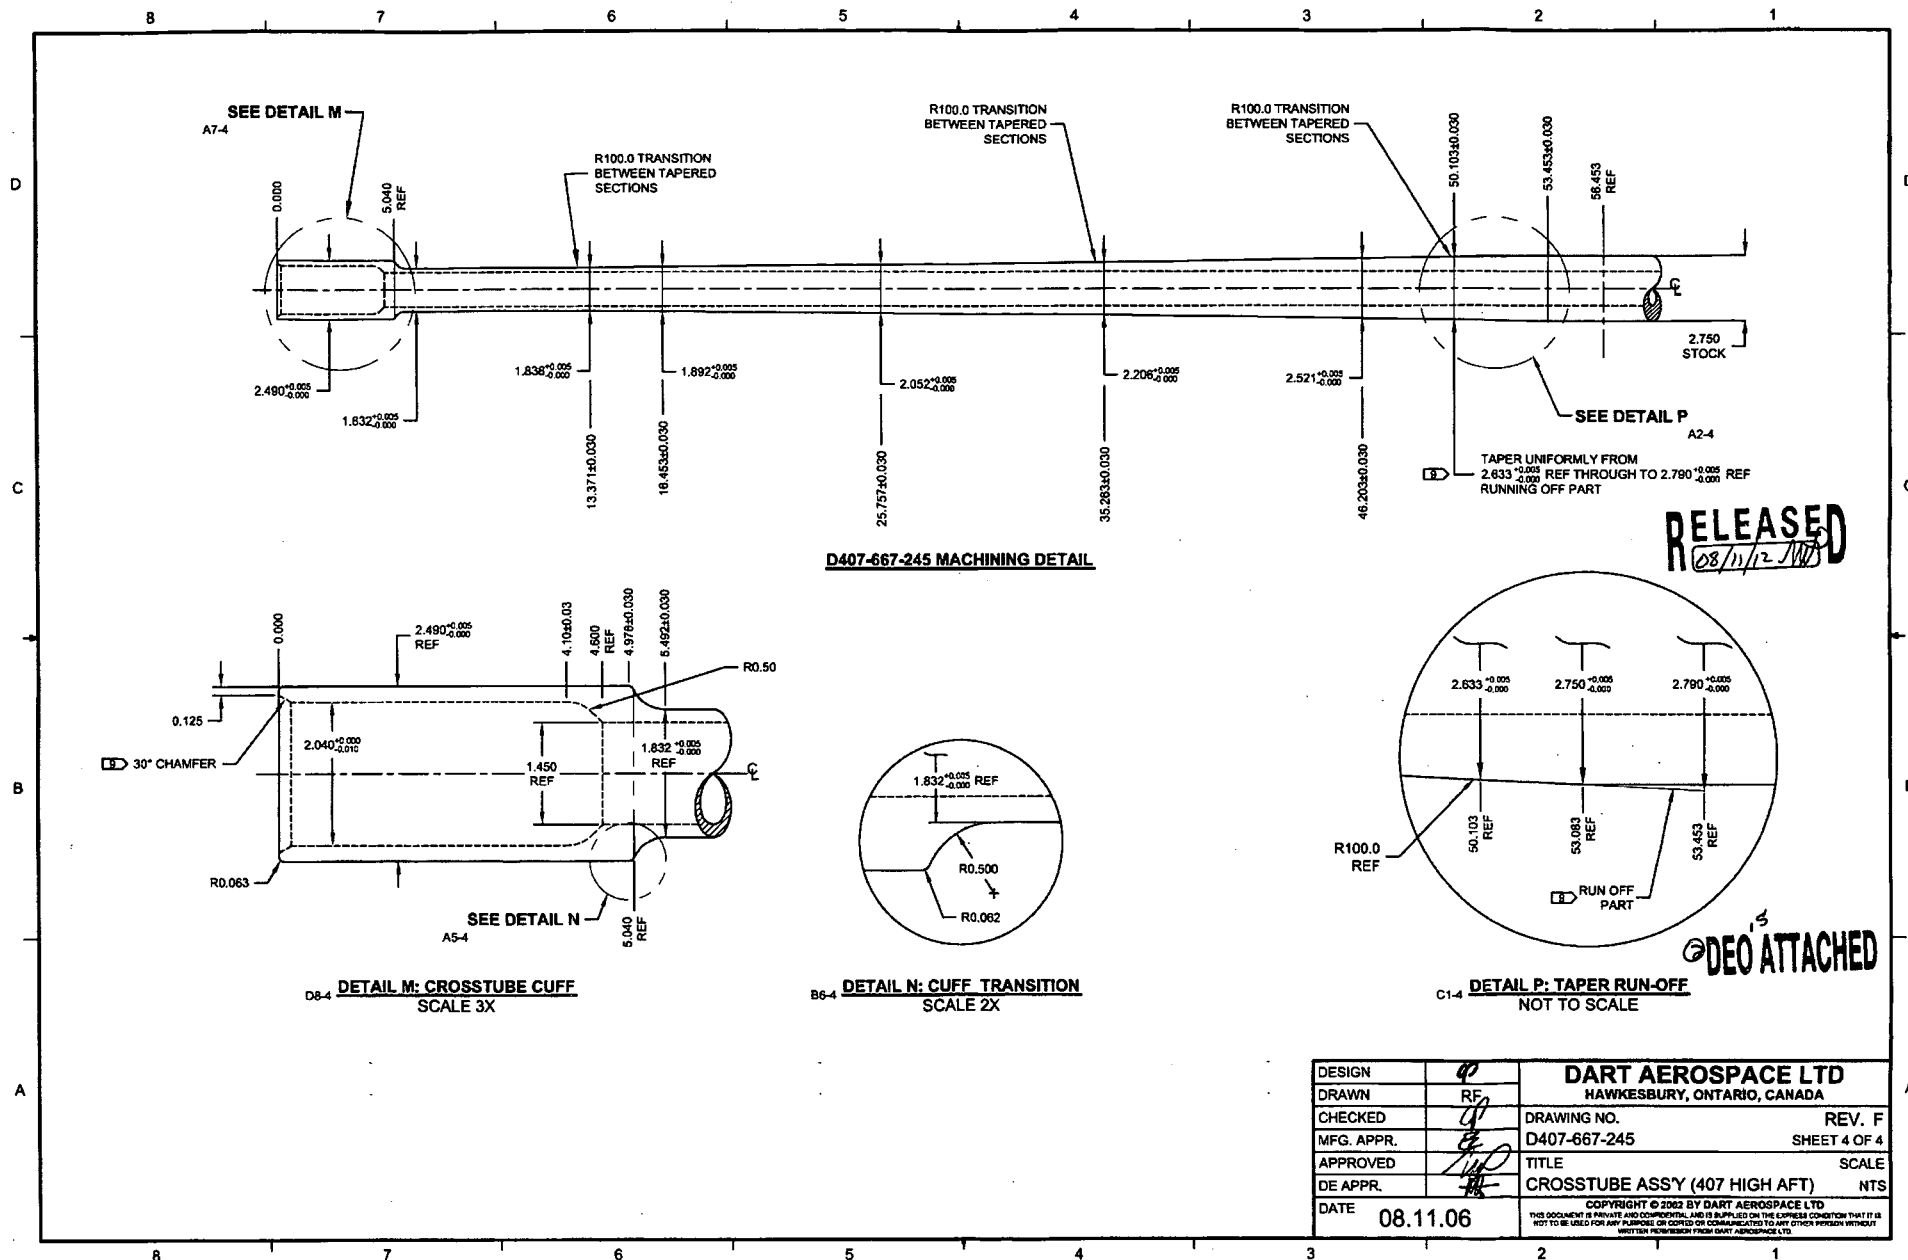

DESIGN	40	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	40	DRAWING NO.	REV. F
MFG. APPR.	40	D407-667-245	SHEET 4 OF 4
APPROVED	40	TITLE	SCALE
DE APPR.	40	CROSSTUBE ASSY (407 HIGH AFT)	NTS
DATE	08.11.06	COPYRIGHT © 2003 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

DRAWING NO. D407-667-245	TITLE CROSSTUBE ASSY (407 HIGH AFT)	REV. F	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D407-667-245-F-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED	DE APPR.			
DATE 11.04.08	DATE 11.04.12	DATE 11.04.12	DATE 11.04.12	DATE 11.04.12	DATE 11.04.12		

PURPOSE:

REMOVED ABRASION STRIP IN FAVOR OF A THIN LAYER OF PROSEAL 890.

CHANGE:

PARTS LIST IS AMENDED AS FOLLOWS:

IS:

Item	Qty -245	Part Number	Description
3	0	D2856-400-773	ABRASION STRIP

WAS:

3	2	D2856-400-773	ABRASION STRIP
---	---	---------------	----------------

NOTES 2 AND 15, SHEET 1 ARE AMENDED AS FOLLOWS:

IS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA) AND
PAINT OUTSIDE PER DART QSI 005 4.2
REMOVE MASKING AND APPLY CLEAR COAT
- 15) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3190-1
CHAFING SHIELDS AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL
PROSEALED D3190-1 CHAFING SHIELDS ONTO CROSSTUBE BY APPLYING A THIN COAT
OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.

WAS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 15) INSTALL D2856-400-773 ABRASION STRIP WITH A 0.13 REF GAP ON BOTTOM SIDE OF
CROSSTUBE PER QSI 035.


RELEASED
2011-04-18

DRAWING NO. D407-667-245	TITLE CROSSTUBE ASSY (407 HIGH AFT)	REV. F	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D407-667-245-F-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED <i>up</i>	MFG. APPR. <i>EE</i>	APPROVED <i>WP</i>	DE APPR. <i>th</i>		
DATE 11.04.08	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12	DATE 11.04.12		

IS:

WAS:

RELEASED
2011-04-18

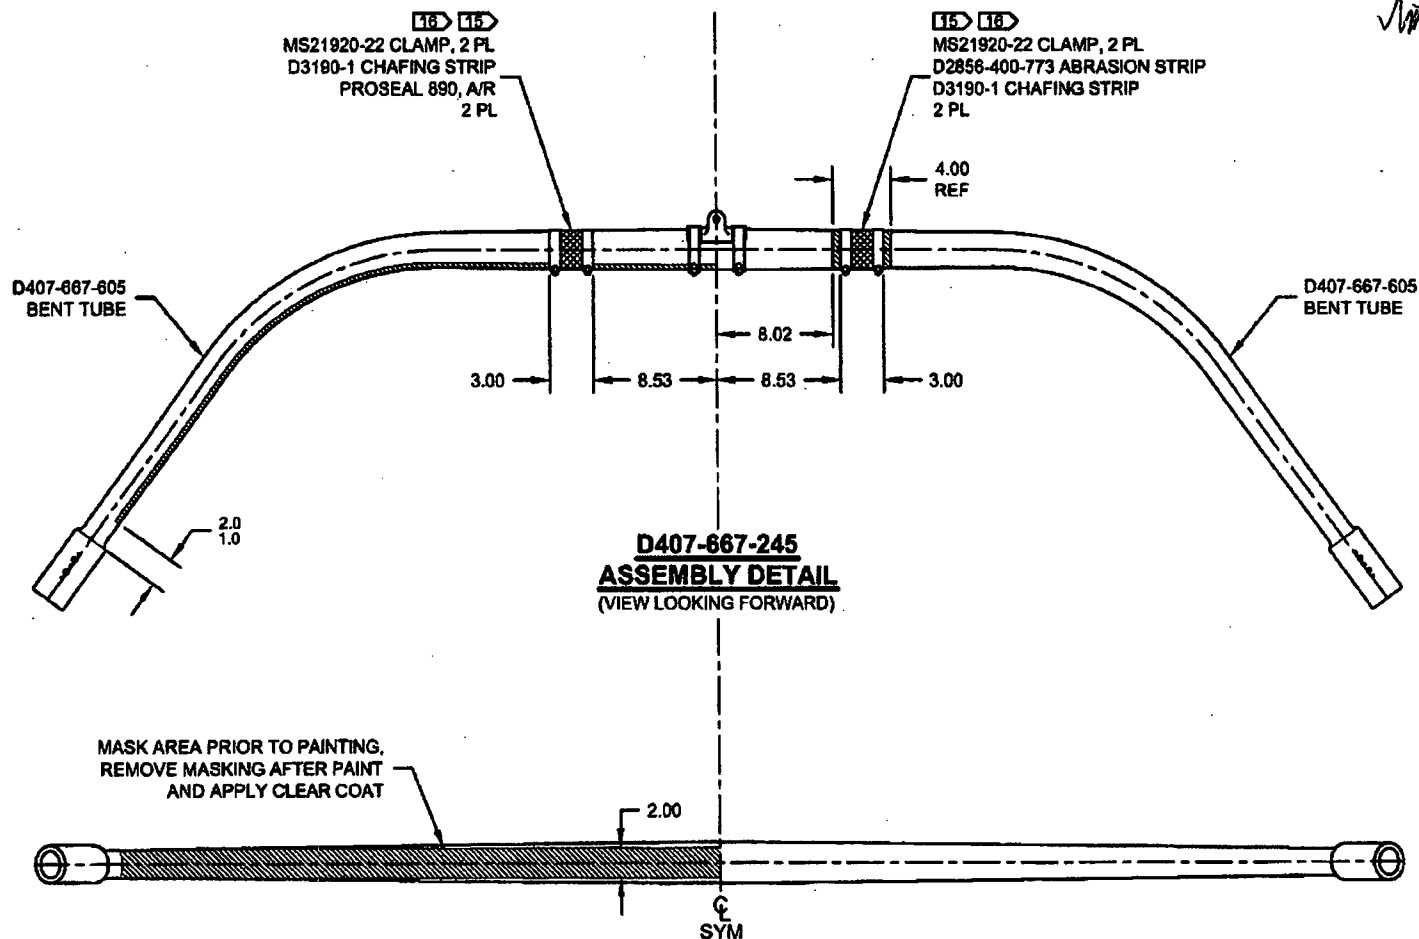

DRAWING NO. D407-667-245	TITLE CROSSTUBE ASS'Y (407 HIGH AFT)	REV. F	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D407-667-245-F-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>q</i>	CHECKED <i>AS</i>	MFG. APPR. <i>E</i>	APPROVED <i>MP</i>		DE APPR. <i>#</i>		
DATE 11.09.07	DATE 11.09.19	DATE 11.09.19	DATE 11.09.19		DATE 11.09.19		

PURPOSE:

REPLACE MAGNOBOND WITH 3M DP460 SCOTCH-WELD EPOXY ADHESIVE

CHANGE:

IS:

Item	Qty -245	Part Number	Description
12	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD

WAS:

12	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
----	-----	----------------	---

NOTE 12 & 17, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) INSTALL D2894-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015. LET CURE FOR 24 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVE HAS CURED FOR 24 HOURS.

WAS:

- 12) INSTALL D2894-1 CENTER SUPPORT USING A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-09-29
MP

Item	QTY -245	PART NUMBER	DESCRIPTION
1	X	D407-667-245	CROSSTUBE ASSEMBLY (407 HIGH AFT)
2	1	D6011-115	CROSSTUBE
3	2	D2856-400-773	ABRASION STRIP
4	2	D2873-043	NUT PLATE
5	2	D2873-045	NUT PLATE
6	1	D2894-1	SUPPORT
7	2	D3190-1	CHAFING SHIELD
8	2	D3595-063-430	RUBBER CUSHION
9	14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
10	4	MS21920-22	CLAMP
11	2	MS21920-25	CLAMP (OR MS21920-24)
12	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947- 100, TYPE II, CLASS 2 ADHESIVE)


GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6011-115
FINISHED LENGTH = 112.91±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D407-667-245" AND BATCH NUMBER ON
INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 27.7 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY. TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 6 PASSES. MAXIMUM TUBE FLATTENING DUE TO
BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2894-1 CENTER SUPPORT USING A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND
6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO
PACKAGING.
- 13) INSTALL MS21920-25 CLAMPS WITH D3595-063-430 RUBBER CUSHIONS TO SECURE D2894-1
SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE CROSSTUBE
SUPPORT.
NOTE: MS21920-24 CLAMPS CAN BE USED TO ACCOMMODATE VARYING DIAMETERS.
ENSURE THERE IS A MINIMUM OF 1.5 THREADS IN SAFETY ON THE NUTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) INSTALL D2856-400-773 ABRASION STRIP WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF
CROSSTUBE, PER QSI 035.
- 16) INSTALL D3190-1 CHAFING SHIELDS SO THAT OVERLAP IS ON BOTTOM SIDE OF CROSSTUBE
OPPOSITE D2894-1 SUPPORT.
- 17) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN
SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

DEO ATTACHED
RELEASED
08/11/06


F	REFORMAT NOTES TO NEW STANDARDS (ZN B8-1); RELOCATED FLAG # 6 (ZN A8-3) PER NCR 210; REMOVED REF. & ADD TOLERANCES (ZN C6-3, C4-3 & D2-3)	RF	08.11.06
E	8.02 AND 8.53 WERE 8.40 AND 8.90 (ZN D5-2); REORGANIZED VIEWS AND REFORMATED DRAWING TO CURRENT STANDARDS. REASONS: CLAMPS MOVED 0.375 TOWARD CL TO ELIMINATE INTERFERENCE WITH AIRCRAFT MOUNTS. REFERENCE: PAR#08-21 AND ECN#1225	MB	08.07.24
D	ADD VIEW FOR OEM SKID HOLES, ROTATE ORIENTATION OF CLAMPS SECTION F-F. REMOVE -851 ABRASION STRIP, ADD MAGNOBOND 6398, ADD CUSHION	PH	07.02.07
C	ADD HOLES AND NUT PLATES FOR COMPATIBILITY WITH BHT/AA SKIDTUBES	PH	05.07.26
B	ADD CHAFING SHIELD	CP	03.05.21
A	NEW ISSUE	CP	02.05.13
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN	RF		
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	08.11.06		

DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWING NO. D407-667-245	REV. F SHEET 1 OF 4
TITLE CROSSTUBE ASS'Y (407 HIGH AFT)	SCALE NTS
COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

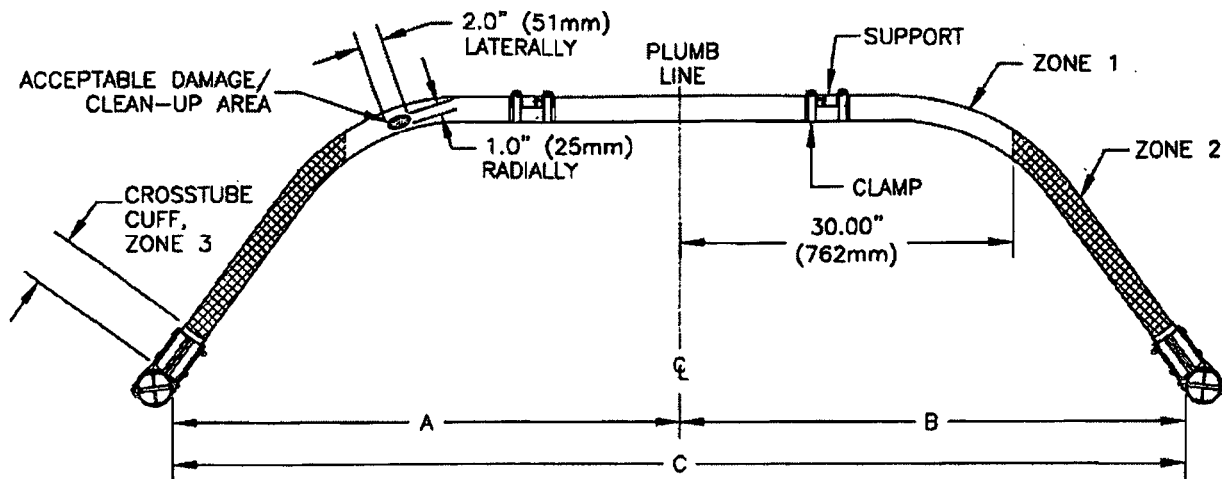

Maximum Nick, Scratch, or Corrosion Damage Depth Limit			
Damage Zone	3	2	1
D407-667-105 High Fwd Crosstube	0.030" (0.76mm)	0.012" (0.30mm)	0.015" (0.38mm)

Figure 5-2: Acceptable Crosstube Damage Limits D407-667-105 Crosstube

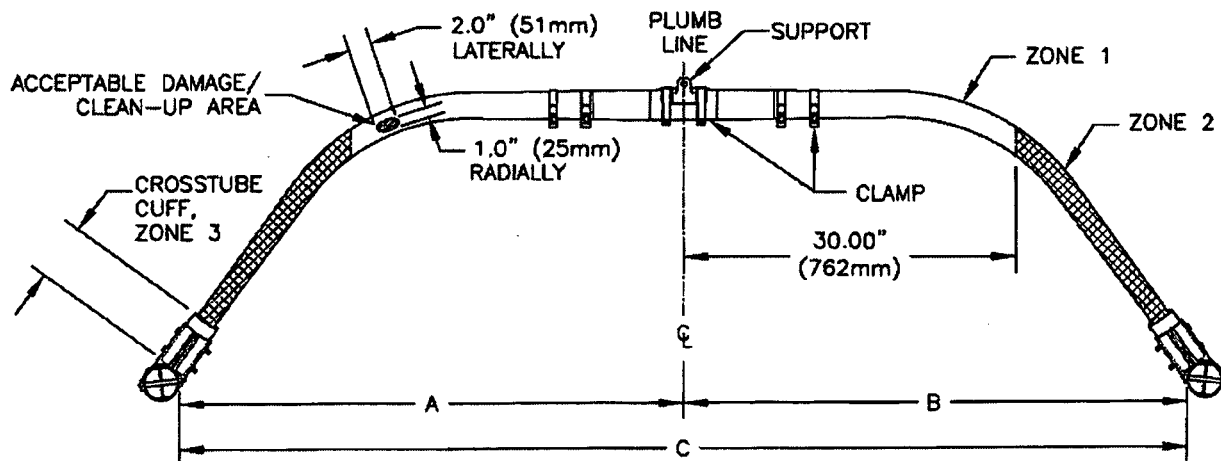

Maximum Nick, Scratch, or Corrosion Damage Depth Limit			
Damage Zone	3	2	1
D407-667-205 High Aft Crosstube	0.030" (0.76mm)	0.015" (0.38mm)	0.015" (0.38mm)


Figure 5-3: Acceptable Crosstube Damage Limits D407-667-205 Crosstube

• COPYRIGHT © 2000 BY DART AEROSPACE LTD. •
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

CHAPTER 5 – INSPECTION REQUIREMENTS (05-00-00)**5.1 DAILY INSPECTION****5.1.1** Inspect the landing gear assembly for

- Mechanical damage (scratches, nicks) and corrosion damage on crosstube
- Elongation of any of the saddle holes
- Cracked saddles or supports
- Break in sealant around the saddles or supports
- Corrosion damage in the vicinity of the saddles or supports
- Looseness in the saddle joint
- Moving or slipping of the supports

If damage or slipping found, perform the 300 hour inspection and repair.

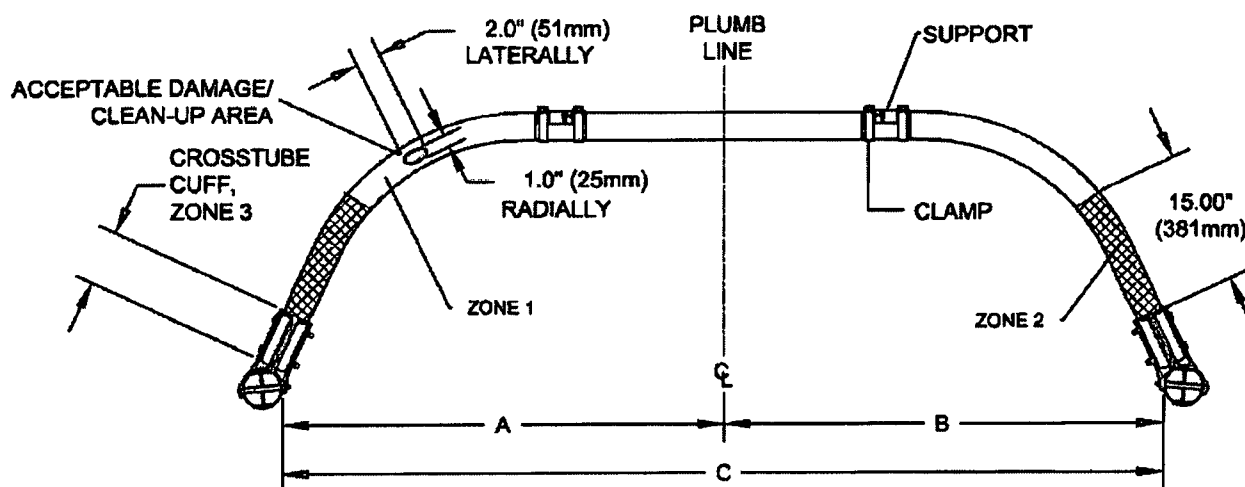5.2 DAMAGE LIMITS


Maximum Nick, Scratch, or Corrosion Damage Depth Limit			
Damage Zone	3	2	1
D206-667-101 High Fwd Crosstube	0.030" (0.76mm)	0.008" (0.20mm)	0.015" (0.38mm)
D206-667-103 High Fwd Crosstube	0.030" (0.76mm)	0.012" (0.30mm)	0.015" (0.38mm)
D206-667-107 Mid Fwd Crosstube			
D206-667-201 High Aft Crosstube	0.030" (0.76mm)	0.015" (0.38mm)	0.015" (0.38mm)
D206-667-203 High Aft Crosstube			
D206-667-207 Mid Aft Crosstube			

Figure 5-1: Acceptable Crosstube Damage Limits
D206-667-101/-103/-107/-201/-203/-207 Crosstubes

• COPYRIGHT © 2000 BY DART AEROSPACE LTD. •
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.


Revision: 3

05-00-00

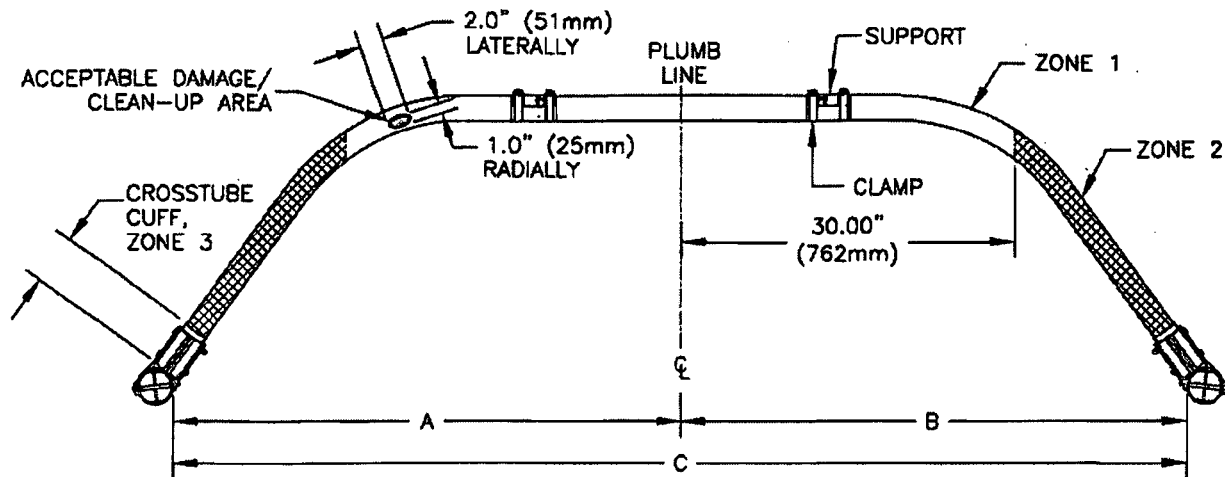

Maximum Nick, Scratch, or Corrosion Damage Depth Limit			
Damage Zone	3	2	1
D407-667-105 High Fwd Crosstube	0.030" (0.76mm)	0.012" (0.30mm)	0.015" (0.38mm)

Figure 5-2: Acceptable Crosstube Damage Limits D407-667-105 Crosstube

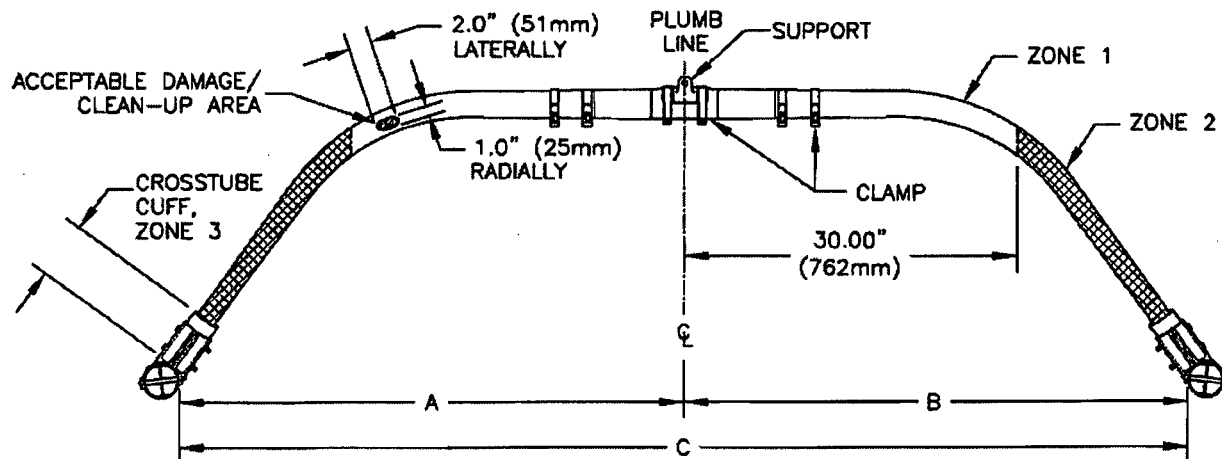

Maximum Nick, Scratch, or Corrosion Damage Depth Limit			
Damage Zone	3	2	1
D407-667-205 High Aft Crosstube	0.030" (0.76mm)	0.015" (0.38mm)	0.015" (0.38mm)

Figure 5-3: Acceptable Crosstube Damage Limits D407-667-205 Crosstube

• COPYRIGHT © 2000 BY DART AEROSPACE LTD. •
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.